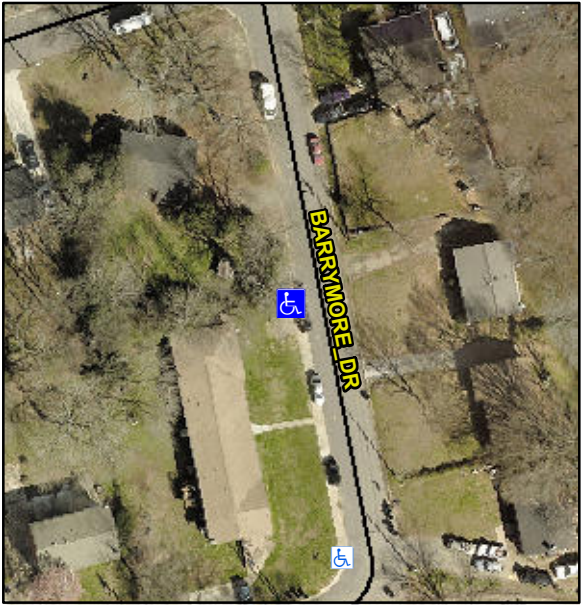


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10013612	Main Street: BARRYMORE_DR	Cross Street: N/A	Location: W
ADA ID: 0B7368ABFC78	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	47.0
			No	Ramp Width (in)	48.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
			To E	X Walk 1 Direction	N/A
			N/A	X Walk 1 Width (in)	N/A
			4.2	X Walk 1 Slope (%)	N/A
			5.0	X Walk 1 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	N/A
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
Surveyor Notes:					
N/A					
PROW/ADA:					
Not Found, R304.5.3					
Total Cost:					
\$ 1850.00					

Street 1 Name	BARRYMORE DR
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

