


Intersection ID: 48643	Main Street: SOCATA_WY	Cross Street: BROCK_RN	Location:	N
ADA ID: 0BD306CAB27E	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp. Remove & Replace Gutter.		N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	5.5
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.0
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	3.4	N/A	Flare Slope RT (%)	0.1
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
	Surveyor Notes:  N/A		Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	0.1	Yes	DWS Length (in)	25.5
			Yes	Landing X Slope (%)	1.9	Yes	DWS Full Width?	Yes
N/A			Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0	
N/A			Shared Landing?	No				
Yes			Gutter Ponding?	No	No	Gutter Slope (%)	7.7	
PROW/ADA:  Not Found, R304.5.4		Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.6	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
			X Walk 1 Direction	To S		X Walk 2 Direction	N/A	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	6.1		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	0.1		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
Total Cost: \$ 2600.00			Obstruction Type			Storm Grate/Utility Type		
				N/A		N/A		
					Yes	Surface Condition? (G/P)	Good	

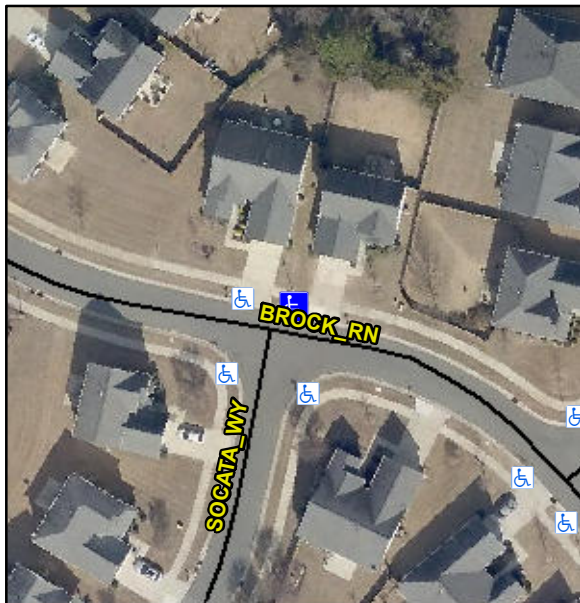