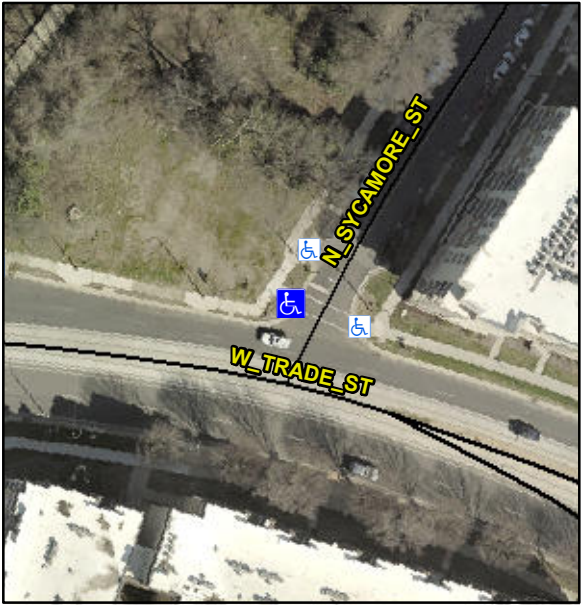


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10040728	Main Street: N_SYCAMORE_ST	Cross Street: N/A	Location: NW
ADA ID: 0C0B4E5EF89D	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 1.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
 <p>Street 1 Name: N SYCAMORE ST</p> <p>Stop Condition-Street 2: StopSign</p> <p>Street 2 Name: N/A</p> <p>Stop Condition-Street 1: N/A</p>	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	120.0	Yes	Ramp Slope (%)	5.2
		Yes	Ramp Width (in)	58.0	No	Ramp XSlope (%)	2.1
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	114.0	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	5.5		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3</p> <p>Total Cost: \$ 1850.00</p>	Road Slope (%)	N/A	N/A	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	N/A	N/A	Clear Space to XWalk (in)	N/A
	Any Obstructions?	N/A	N/A	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type					Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good

