


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 20874	Main Street: STEELE_CREEK_RD	Cross Street: WESTINGHOUSE_COMMONS_DR	Location: NW
ADA ID: 0C57CA018166	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	80.0	N/A	Grade Break?	N/A
			Yes	Ramp Width (in)	60.0	N/A	Grade Break Slope (%)	0.0
			Yes	Ramp Slope (%)	3.1	N/A	Grade Break XSlope (%)	0.0
			No	Ramp XSlope (%)	4.1			
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
	N/A		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A	
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A	
PROW/ADA:		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A	
R304.5.3		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A	
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No		Road Slope (%)	1.2	
			X Walk 1 Direction	To SW		Road X Slope (%)	2.8	
			X Walk 1 Width (in)	N/A		Clear Space?	N/A	
			X Walk 1 Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A	
			X Walk 1 X Slope (%)	2.8	N/A	Storm Grate/Utility Hazard?	N/A	
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type		
		N/A	Any Obstructions?	N/A			N/A	
			Obstruction Type		Yes	Surface Condition? (G/P)	Good	
					N/A	Curb Slope (%)	2.0	
Total Cost:		\$ 1600.00						
Street 1 Name		ENTRANCE						
Stop Condition-Street 1		StopSign						
Street 2 Name		N/A						
Stop Condition-Street 2		N/A						

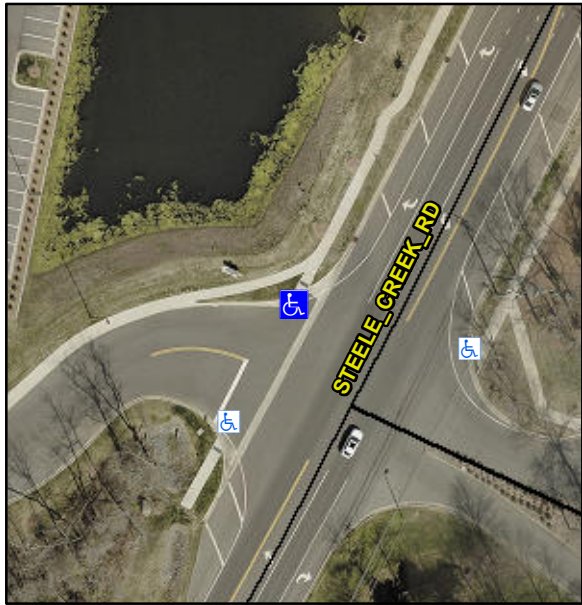