

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

8.8

5.1

N/A

N/A

Intersection ID: 27355 Main Street: JOHNSTON RD Cross Street: BRIXHAM HILL AV Location: SW **Overall Compliance: No** ADA ID: 0CA767D4D2BC Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:** 25

Compliance Description

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Flare Type LT

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

48.0 No

N/A N/A

N/A N/A

Data

26.0 No


Compliance Description

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

Flare Type RT

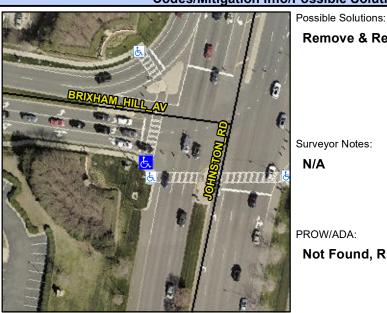

Remove & Replace Entire Ramp.	N/A
•	Yes
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
Not Found, R304.2.2, R304.5.3	N/A
, ,	N/A
	N/A
	N/A

470-400	The state of the s
1	



SANATIANT PHILL AV					N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
m m m					N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
77		Surveyor Notes:			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
E L		N/A			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
6. S					N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
0	8				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
A LAND MALE					N/A	Shared Landing?	N/A			
	PROW/ADA:			N/A	Gutter Ponding?		N/A	Gutter Slope (%)	N/A	
	Not Found, R304.2.2	R304.5.3		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
	All . 5 5300		,		N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
						X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
FEE MO	E F				N/A	X Walk 1 Width (in)	112.0	N/A	X Walk 2 Width (in)	N/A
Street 1 Name	BRIXHAM HILL AV					X Walk 1 Slope (%)	6.0		X Walk 2 Slope (%)	N/A
Stop Condition-Street 2	Signal					X Walk 1 X Slope (%)	5.2		X Walk 2 X Slope (%)	N/A
Street 2 Name	N/A				N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 1	N/A					Road Slope (%)	N/A	N/A	Clear Space?	N/A
						Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
					N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Total Cost:	\$	1850.00		Obstruction Type			Storm Grate/Utility Type	
							N/A			N/A
								Yes	Surface Condition? (G/P)	Good
			A STATE				·			