


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 7448	Main Street: ROCKY_RIVER_RD	Cross Street: GRIER_RD	Location: NW
ADA ID: 0CC76DB84B78	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Compliance	Description	Data
			N/A	Ramp Length LT (in)	70.0
			Yes	Ramp Width LT (in)	70.0
			Yes	Ramp Slope LT (%)	3.5
			No	Ramp XSlope LT (%)	6.2
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>LT & RT RP SL < 5%, DAMAGED DWS</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	Ramp Length RT (in)	57.0
			Yes	Ramp Width RT (in)	64.0
			Yes	Ramp Slope RT (%)	4.2
			No	Ramp XSlope RT (%)	5.6
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	Yes
				X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	85.5
				X Walk 1 Slope (%)	0.3
				X Walk 1 X Slope (%)	0.9
			N/A	Ramp inside XWalk1?	Yes
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
<p>Total Cost:</p> <p>\$ 1600.00</p>			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			Replace	Curb Slope (%)	16.5

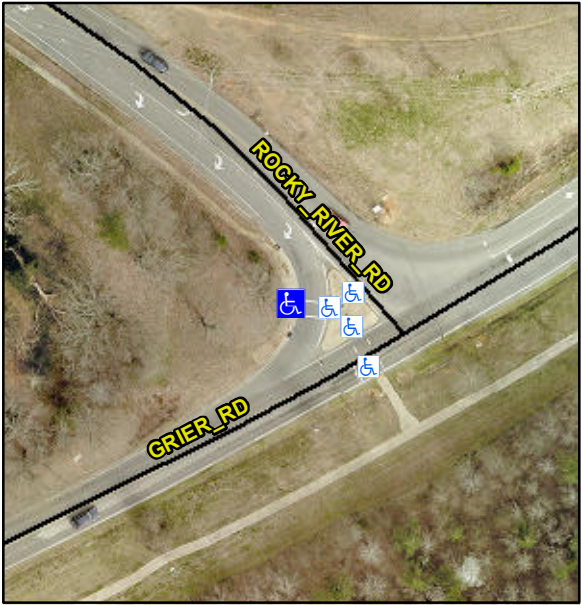