

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

8.5

1.1

N/A

Good

Intersection ID: 27363Main Street:REA_RDCross Street:BALLANTYNE_COMMONS_PYLocation:NEADA ID: 0CECCE1CD960Ramp Type:PerpInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:21.25

Compliance Description

N/A

No

N/A

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Gutter Lip Ht (in)

Painted X Walk1?

X Walk 1 Direction

X Walk 1 Width (in)

X Walk 1 Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Road Slope (%)

Road X Slope (%)

Any Obstructions?

Obstruction Type

Flare Traversable LT?

Flare Type LT

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

Yes

N/A

Yes

Compliance Description

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Flare Type RT

Data

108.0

39.0

N/A

Yes

To SW

110.0

4.0

2.1


Yes

N/A

N/A

N/A

N/A

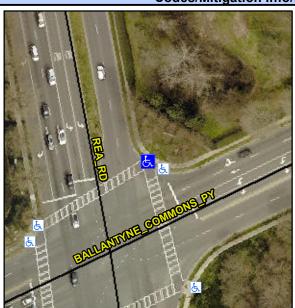

Street 1 Name	REA RD
Stop Condition-Street 2	Signal
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:
Remove & Replace Entire Ramp.
Surveyor Notes:
N/A
DDOW/ADA
PROW/ADA:
Not Found, R304.5.1, R304.2.2
-

Total Cost:	\$ 1850.00





