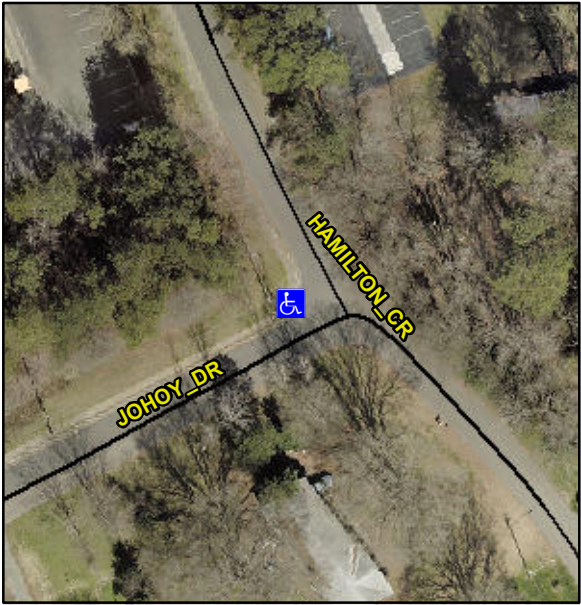


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                       |                          |                         |                        |
|-----------------------|--------------------------|-------------------------|------------------------|
| Intersection ID: 5674 | Main Street: HAMILTON_CR | Cross Street: JOHOY_DR  | Location: NW           |
| ADA ID: 0D0567EE2929  | Ramp Type: Perp          | Initial Pass/Fail: Fail | Overall Compliance: No |
|                       |                          |                         | Severity Score: 13.75  |

| Codes/Mitigation Info/Possible Solution                                                               |                                          |  | Field Measurements/Component Compliance |                             |             |
|-------------------------------------------------------------------------------------------------------|------------------------------------------|--|-----------------------------------------|-----------------------------|-------------|
|                       | Possible Solutions:                      |  | <b>Compliance</b>                       | <b>Description</b>          | <b>Data</b> |
|                                                                                                       | <b>Remove &amp; Replace Entire Ramp.</b> |  | <b>No</b>                               | Ramp Length (in)            | <b>60.0</b> |
|                                                                                                       |                                          |  | <b>Yes</b>                              | Ramp Width (in)             | <b>48.0</b> |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Flare Type LT               | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Flare Slope LT (%)          | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Flare Traversable LT?       | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Landing Length (in)         | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Landing Width (in)          | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Landing Slope (%)           | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Landing X Slope (%)         | <b>N/A</b>  |
| <p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.2.2, R304.5.3</b></p> |                                          |  | <b>N/A</b>                              | Flare Type RT               | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Flare Slope RT (%)          | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Flare Traversable RT?       | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | DWS Provided?               | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | DWS Contrast?               | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | DWS Length (in)             | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | DWS Full Width?             | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | DWS Offset (in)             | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Gutter Ponding?             | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Gutter Lip Ht (in)          | <b>N/A</b>  |
| <p>Total Cost:</p> <p><b>\$ 1850.00</b></p>                                                           |                                          |  | <b>No</b>                               | Painted X Walk2?            | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>To E</b>                             | X Walk 2 Direction          | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | X Walk 2 Width (in)         | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>1.4</b>                              | X Walk 2 Slope (%)          | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>1.4</b>                              | X Walk 2 X Slope (%)        | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Ramp inside XWalk2?         | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>1.4</b>                              | Clear Space?                | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>1.4</b>                              | Clear Space to XWalk (in)   | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Storm Grate/Utility Hazard? | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Storm Grate/Utility Type    | <b>N/A</b>  |
|                                                                                                       |                                          |  | <b>N/A</b>                              | Surface Condition? (G/P)    | <b>Good</b> |

