


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 24621	Main Street: HUGH_FOREST_RD	Cross Street: WALTHAM_LN	Location: SW
ADA ID: 0D7A058CD290	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
 <p>Street 1 Name                      <b>HUGH FOREST RD</b></p> <p>Stop Condition-Street 2                      <b>None</b></p> <p>Street 2 Name                      <b>WALTHAM LN</b></p> <p>Stop Condition-Street 1                      <b>StopSign</b></p>	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>No</b>	Ramp Length (in)	<b>59.5</b>
			<b>Yes</b>	Ramp Width (in)	<b>48.0</b>
			<b>N/A</b>	Flare Type LT	<b>N/A</b>
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
			<b>N/A</b>	Shared Landing?	<b>N/A</b>
			<b>N/A</b>	Gutter Ponding?	<b>N/A</b>
			<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>
			<b>No</b>	Painted X Walk1?	<b>No</b>
			<b>To E</b>	X Walk 1 Direction	<b>To N</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>
			<b>1.5</b>	X Walk 1 Slope (%)	<b>2.4</b>
			<b>0.5</b>	X Walk 1 X Slope (%)	<b>2.4</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.2.2</b></p>			<b>N/A</b>	Ramp inside XWalk2?	<b>N/A</b>
			<b>2.4</b>	Road Slope (%)	<b>N/A</b>
			<b>1.7</b>	Road X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Any Obstructions?	<b>N/A</b>
				Obstruction Type	
			<b>N/A</b>		<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
Total Cost:		\$ 3200.00			

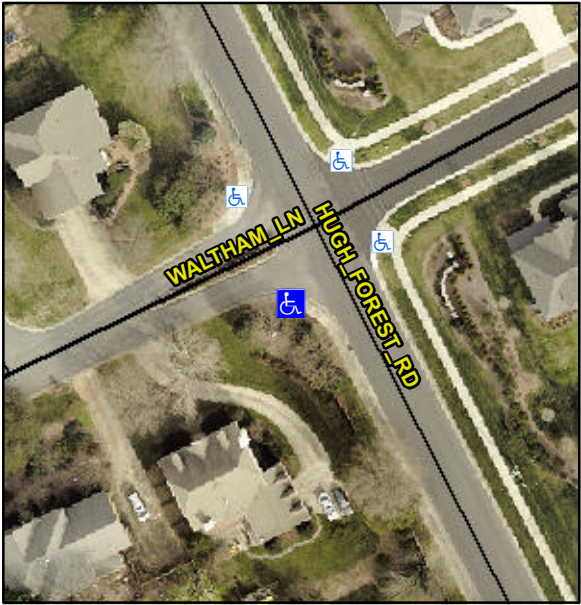