

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5832	Main Street: N_TRYON_ST	Cross Street: KEN_HOFFMAN_DR	Location:	N
ADA ID: 0D9324C7D5EB	Ramp Type: Combination2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 7.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

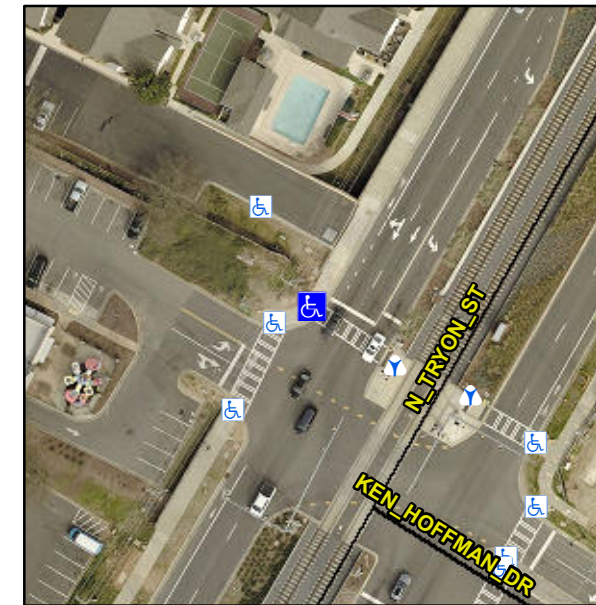

Possible Solutions:

Grind Gutter Lip.

Surveyor Notes:

N/A

PROW/ADA:

R302.7.2

Total Cost:

\$ 200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	N/A	N/A	Ramp Length RT (in)	52.0
N/A	Ramp Width LT (in)	N/A	Yes	Ramp Width RT (in)	71.0
N/A	Ramp Slope LT (%)	N/A	Yes	Ramp Slope RT (%)	5.1
N/A	Ramp XSlope LT (%)	N/A	Yes	Ramp XSlope RT (%)	1.0
N/A	Ramp Length (in)	45.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	4.5	N/A	Flare Slope RT (%)	5.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	71.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.4	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.4
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	N/A

