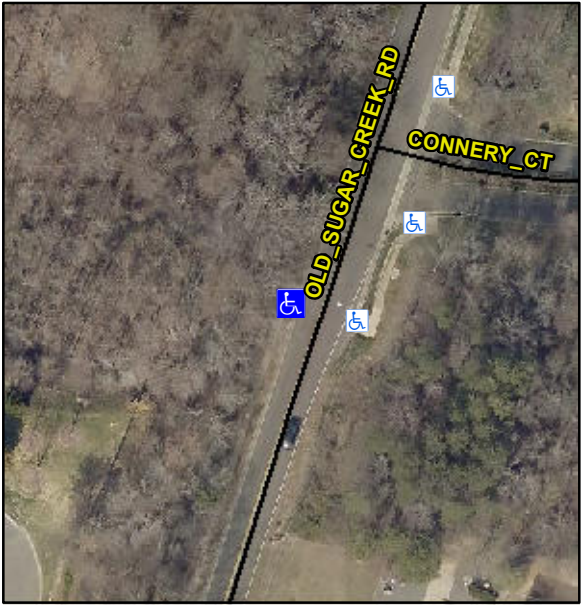


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 4171	Main Street: CONNERY_CT	Cross Street: OLD_SUGAR_CREEK_RD	Location: W
ADA ID: 0D95A622D2A0	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	73.5
			No	Ramp Width LT (in)	47.5
			Yes	Ramp Slope LT (%)	7.8
			Yes	Ramp XSlope LT (%)	1.5
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1</p>			N/A	Ramp Length RT (in)	70.5
			No	Ramp Width RT (in)	46.5
			Yes	Ramp Slope RT (%)	7.1
			Yes	Ramp XSlope RT (%)	1.6
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	1.0
				X Walk 1 X Slope (%)	1.4
			N/A	Ramp inside XWalk1?	N/A
				Road Slope (%)	N/A
				Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
Total Cost:		\$ 1600.00			
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.6

