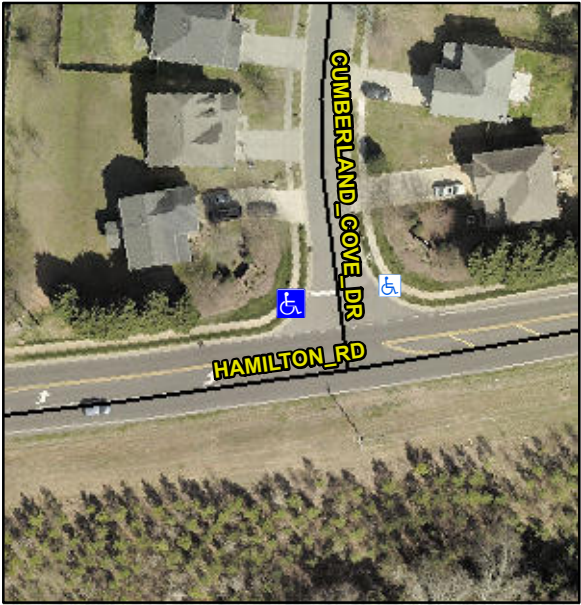


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46742	Main Street: HAMILTON_RD	Cross Street: CUMBERLAND_COVE_DR	Location: NW
ADA ID: 0F3703F37BBA	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
 <p>Street 1 Name CUMBERLAND COVE DR</p> <p>Stop Condition-Street 2 None</p> <p>Street 2 Name HAMILTON RD</p> <p>Stop Condition-Street 1 StopSign</p>	Possible Solutions:	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.			
	Surveyor Notes:	N/A			
	PROW/ADA:	R304.5.1			
	Total Cost:	\$ 3200.00			
			Compliance	Description	Data
			Yes	Ramp Slope (%)	7.2
			No	Ramp Width (in)	1.2
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	No
			To S	X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	N/A
			1.7	X Walk 1 Slope (%)	3.8
			4.2	X Walk 1 X Slope (%)	2.3
			N/A	Ramp inside XWalk1?	N/A
			0.7	Road Slope (%)	N/A
			4.0	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
			N/A	Obstruction Type	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good

