


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28614	Main Street: KESTRAL_RIDGE_DR	Cross Street: WARBLER_WOOD_CT	Location: SE
ADA ID: 0F4DDA816C55	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 22.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

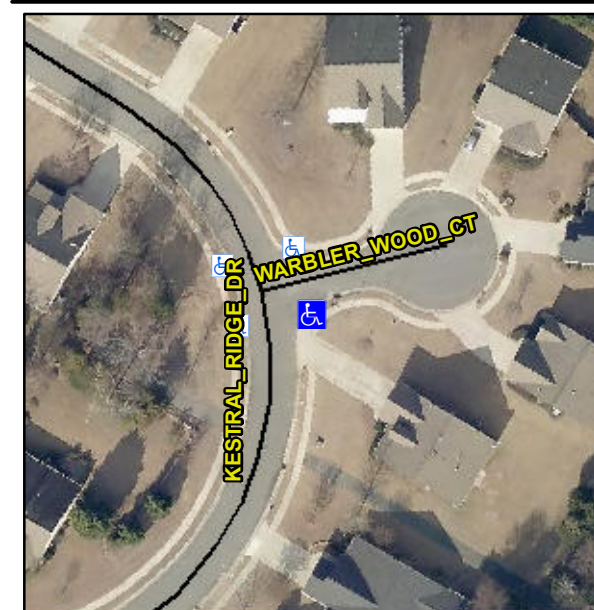

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R305.1.4, R302.7.2, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	6.4
Yes	Ramp Width (in)	100.0	Yes	Ramp XSlope (%)	1.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	3.9	Yes	Flare Slope RT (%)	0.1
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	47.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	118.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.7	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.8
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To N		X Walk 2 Direction	To W
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	1.3
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	2.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.3	N/A	Clear Space?	Yes
	Road X Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

