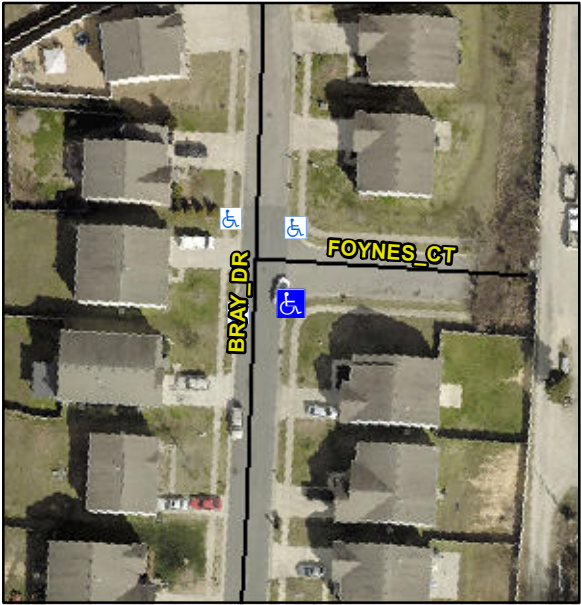


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 42927	Main Street: BRAY_DR	Cross Street: FOYNES_CT	Location: SE
ADA ID: 100033CFFA99	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 46.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		N/A	Ramp Length (in)	47.0	No
			No	Ramp Width (in)	40.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To N	To W
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	3.6	X Walk 2 Slope (%)
				X Walk 1 X Slope (%)	0.6	X Walk 2 X Slope (%)
			N/A	Ramp inside XWalk1?	N/A	N/A
<p>Surveyor Notes:</p> <p>N/A</p>				Road Slope (%)	1.4	N/A
				Road X Slope (%)	0.8	N/A
<p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.2.2, R304.5.3</b></p>			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
Total Cost:		\$ 3200.00				
					N/A	N/A
					Yes	Surface Condition? (G/P) Good

