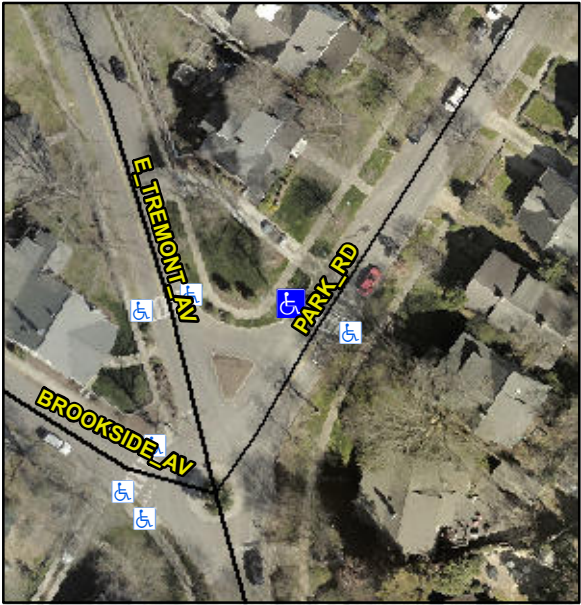


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 47361	Main Street: PARK_RD	Cross Street: N/A	Location: NE
ADA ID: 1082F97C4EEA	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		No	Ramp Slope (%)	9.0
			Yes	Ramp Width (in)	2.1
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			Yes	Painted X Walk1?	N/A
			To SE	X Walk 1 Direction	N/A
			103.0	X Walk 1 Width (in)	N/A
			3.6	X Walk 1 Slope (%)	N/A
			3.3	X Walk 1 X Slope (%)	N/A
			Yes	Ramp inside XWalk1?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2</p>			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 1850.00			
Street 1 Name		PARK RD			
Stop Condition-Street 2		None			
Street 2 Name		N/A			
Stop Condition-Street 1		N/A			

