


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28462	Main Street: WESTWINDS_CT	Cross Street: LAWING_SCHOOL_RD	Location: NE
ADA ID: 109DF7552D07	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 7.5			

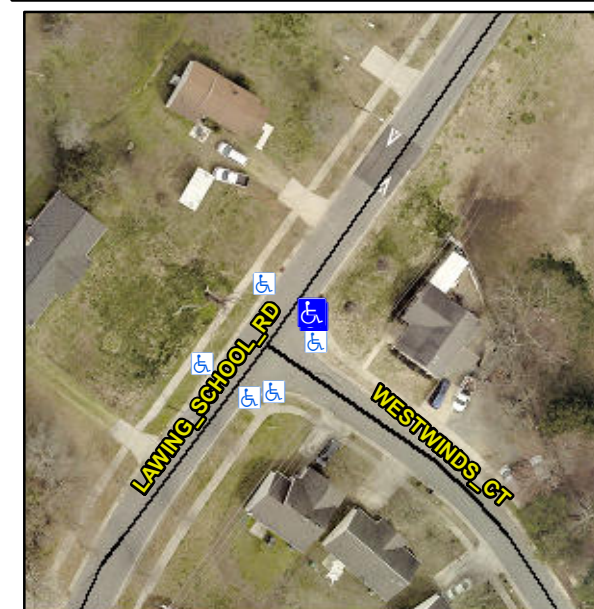

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-
Para, R305.1.4, R305.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	84.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	48.0	Yes	Grade Break Slope (%)	2.0
Yes	Ramp Slope (%)	3.2	Yes	Grade Break XSlope (%)	0.3
Yes	Ramp XSlope (%)	0.1			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	56.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	67.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.1	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	17.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	3.0
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	No		Road Slope (%)	2.0
	X Walk 1 Direction	To NW		Road X Slope (%)	0.5
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.5	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.4

Total Cost: \$ 2350.00

