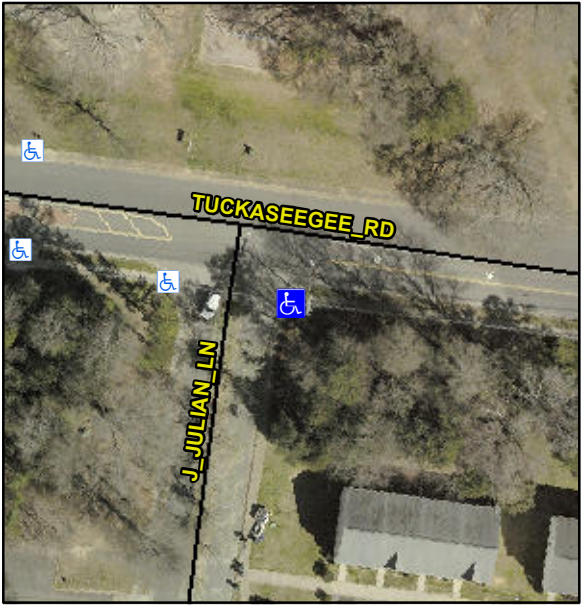


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 9723	Main Street: J JULIAN LN	Cross Street: TUCKASEEGEE_RD	Location:	E
ADA ID: 10FB01AFF3EE	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length (in)	<b>73.0</b>	<b>Yes</b>
			<b>No</b>	Ramp Width (in)	<b>47.5</b>	<b>No</b>
			<b>N/A</b>	Flare Type LT	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Shared Landing?	<b>N/A</b>	
			<b>N/A</b>	Gutter Ponding?	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Painted X Walk1?	<b>No</b>	<b>N/A</b>
				X Walk 1 Direction	<b>To W</b>	<b>N/A</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>	<b>N/A</b>
				X Walk 1 Slope (%)	<b>4.2</b>	<b>N/A</b>
				X Walk 1 X Slope (%)	<b>6.2</b>	<b>N/A</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.5.3</b></p>			<b>N/A</b>	Road Slope (%)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Road X Slope (%)	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	Any Obstructions?	<b>N/A</b>	<b>N/A</b>
				Obstruction Type		
					<b>N/A</b>	<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)		<b>Good</b>
Total Cost:		\$ 1850.00				

