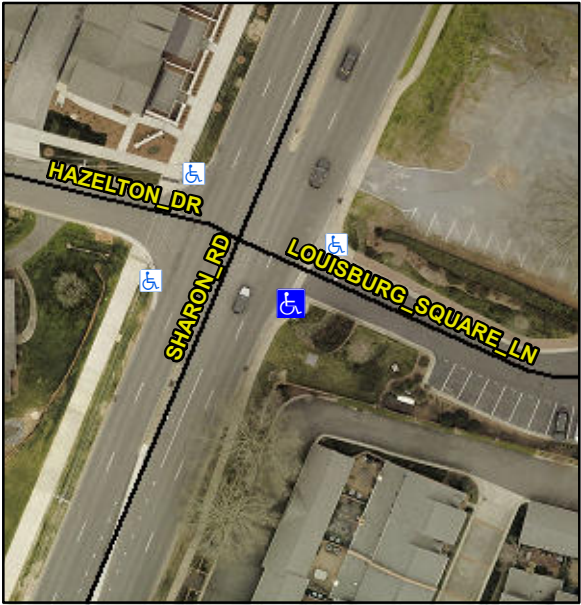


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 20662	Main Street: SHARON_RD	Cross Street: HAZELTON_DR	Location: SE
ADA ID: 11E67B463877	Ramp Type: ParaDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:	Compliance	Description	Data	Compliance
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.	N/A	Ramp Length LT (in)	41.5	N/A
		Yes	Ramp Width LT (in)	61.0	Yes
<p>Surveyor Notes:</p> <p>RT RP < 5%</p>		Yes	Ramp Slope LT (%)	8.0	Yes
		Yes	Ramp XSlope LT (%)	1.6	No
		Yes	Landing Length (in)	59.0	Yes
<p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>		Yes	Landing Width (in)	48.0	Yes
		Yes	Landing Slope (%)	1.5	Yes
		No	Landing X Slope (%)	3.7	Yes
		N/A	Landing Curb? (Y/N)	No	Yes
		N/A	Shared Landing?	No	
		Yes	Gutter Ponding?	No	Yes
		Yes	Gutter Lip Ht (in)	0.0	No
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To NE	
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	0.2	
			X Walk 1 X Slope (%)	2.9	
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	2.0	N/A
			Road X Slope (%)	0.7	N/A
		Yes	Any Obstructions?	No	Yes
			Obstruction Type		
Total Cost:		\$	3950.00		
				N/A	N/A
				Yes	Surface Condition? (G/P)
				Replace	Curb Slope (%)
					16.8

