


Intersection ID: 13802		Main Street: LEXINGTON_AV		Cross Street: MYRTLE_AV		Location:		E			
ADA ID: 122BA1F279F4		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 1.25			
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance							
<div></div> <div>Street 1 NameMYRTLE AV Stop Condition-Street 1StopSign Street 2 NameN/A Stop Condition-Street 2N/A</div>				Possible Solutions:		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		24.0	
<div>Surveyor Notes: ASP LIP 1.0"</div> <div>PROW/ADA: R304.5.3</div>				Yes		Ramp Width (in)		60.0			
				Yes		Ramp Slope (%)		7.2			
				No		Ramp XSlope (%)		2.7			
				N/A		Flare Type LT		N/A			
				N/A		Flare Slope LT (%)		N/A			
				N/A		Flare Traversable LT?		N/A			
				N/A		Landing Length (in)		0.0			
				N/A		Landing Width (in)		0.0			
				N/A		Landing Slope (%)		0.0			
				N/A		Landing X Slope (%)		0.0			
				N/A		Landing Curb? (Y/N)		N/A			
				N/A		Shared Landing?		N/A			
				N/A		Gutter Ponding?		0.0			
				N/A		Gutter Lip Ht (in)		0.0			
				N/A		Painted X Walk1?		No			
						X Walk 1 Direction		To NW			
						X Walk 1 Width (in)		N/A			
						X Walk 1 Slope (%)		5.3			
						X Walk 1 X Slope (%)		3.1			
				N/A		Ramp inside XWalk1?		N/A			
				N/A		Any Obstructions?		N/A			
						Obstruction Type		Yes			
Total Cost: \$ 1600.00						Surface Condition? (G/P)		Good			
						Curb Slope (%)		N/A			
						Grade Break?		N/A			
						Grade Break Slope (%)		0.0			
						Grade Break XSlope (%)		0.0			
						Flare Type RT		N/A			
						Flare Slope RT (%)		0.0			
						Flare Traversable RT?		N/A			
						DWS Provided?		N/A			
						DWS Contrast?		N/A			
						DWS Length (in)		N/A			
						DWS Full Width?		N/A			
						DWS Offset LT (in)		N/A			
						DWS Offset RT (in)		N/A			
						Gutter Slope (%)		N/A			
						Gutter X Slope (%)		N/A			
						Road Slope (%)		5.3			
						Road X Slope (%)		3.1			
						Clear Space?		N/A			
						Clear Space to XWalk (in)		N/A			
						Storm Grate/Utility Hazard?		N/A			
						Storm Grate/Utility Type					
								N/A			

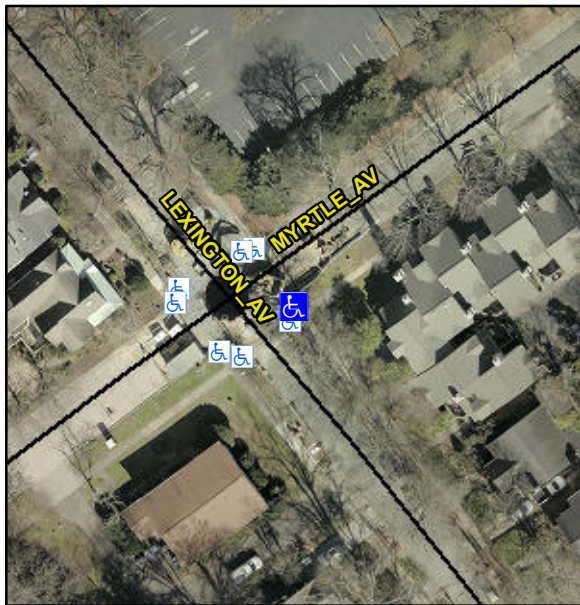