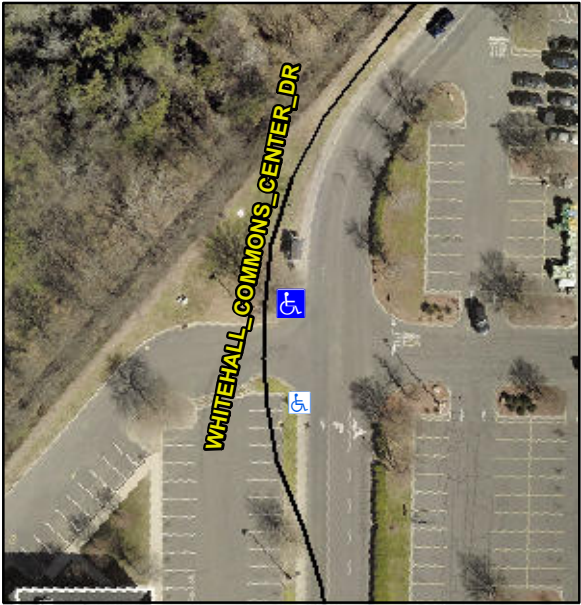


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: YORK_CENTER_DR	Cross Street: N/A	Location: NW
ADA ID: 12545D6D7C40	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 21.25			

	Possible Solutions:		Compliance		Description		Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A		Ramp Length (in)		24.0	No	Ramp Slope (%)	9.0
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1, R304.2.2			No		Ramp Width (in)		44.0	Yes	Ramp XSlope (%)	1.5
			N/A		Flare Type LT		N/A	N/A	Flare Type RT	N/A
Street 1 Name ENTRANCE Stop Condition-Street 2 None Street 2 Name YORK CENTER DR Stop Condition-Street 1 None			N/A		Flare Slope LT (%)		N/A	N/A	Flare Slope RT (%)	N/A
			N/A		Flare Traversable LT?		N/A	N/A	Flare Traversable RT?	N/A
Total Cost: \$ 3200.00			N/A		Landing Length (in)		N/A	N/A	DWS Provided?	N/A
			N/A		Landing Width (in)		N/A	N/A	DWS Contrast?	N/A
			N/A		Landing Slope (%)		N/A	N/A	DWS Length (in)	N/A
			N/A		Landing X Slope (%)		N/A	N/A	DWS Full Width?	N/A
			N/A		Landing Curb? (Y/N)		N/A	N/A	DWS Offset (in)	N/A
			N/A		Shared Landing?		N/A			
			N/A		Gutter Ponding?		N/A	N/A	Gutter Slope (%)	N/A
			N/A		Gutter Lip Ht (in)		N/A	N/A	Gutter X Slope (%)	N/A
			N/A		Painted X Walk1?		No	N/A	Painted X Walk2?	No
					X Walk 1 Direction		To S		X Walk 2 Direction	To E
			N/A		X Walk 1 Width (in)		N/A	N/A	X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)		0.9		X Walk 2 Slope (%)	0.2
					X Walk 1 X Slope (%)		0.7		X Walk 2 X Slope (%)	0.9
			N/A		Ramp inside XWalk1?		N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)		1.0	N/A	Clear Space?	N/A
					Road X Slope (%)		0.2	N/A	Clear Space to XWalk (in)	N/A
			N/A		Any Obstructions?		N/A	N/A	Storm Grate/Utility Hazard?	N/A
					Obstruction Type				Storm Grate/Utility Type	
								N/A		N/A
								Yes	Surface Condition? (G/P)	Good

