


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10025368	Main Street: E_8TH_ST	Cross Street: N BREVARD ST	Location: W
ADA ID: 12575D55C121	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

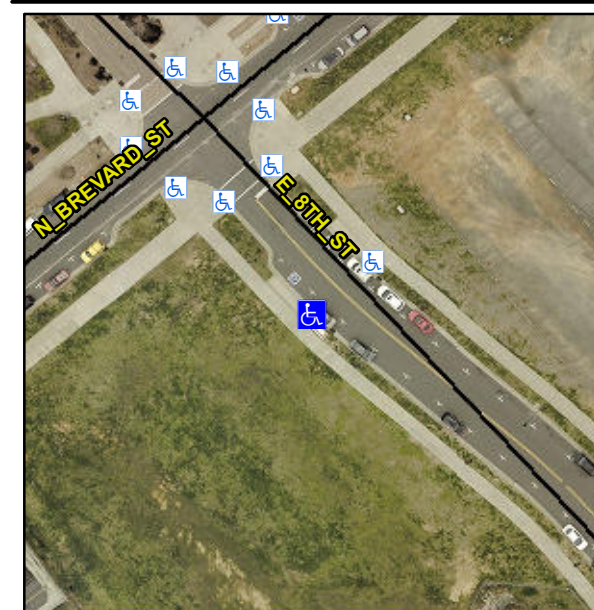

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**ACCESS AISLE RAMP**

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3, R305, R304.5.4**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	73.0	Yes	BlendTrans Slope (%)	1.7
Yes	Ramp Width (in)	60.0	Yes	BlendTrans XSlope (%)	1.3
Yes	Flare Type	Curbed_NoWalkSurface	No	Flare Type	Curbed_WithWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	No	DWS Provided?	No
Yes	Landing Width (in)	71.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.7	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.1	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	N/A
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.0		Clear Space?	Yes
	Road X Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.8

