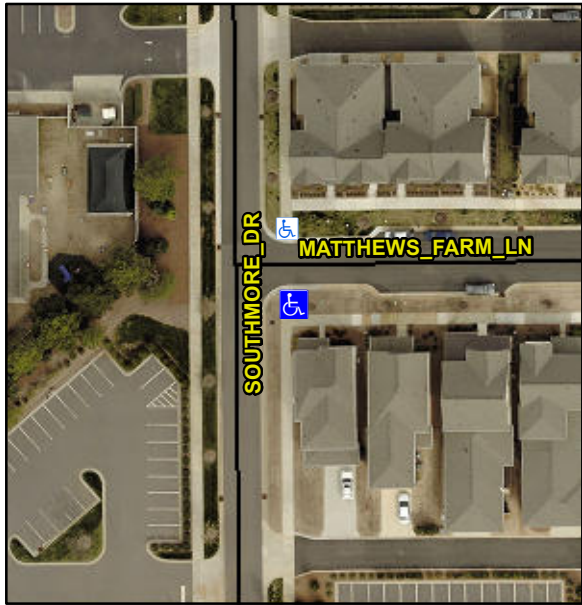


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53487	Main Street: SOUTHMORE_DR	Cross Street: MATTHEWS_FARM_LN	Location: SE
ADA ID: 128E8F21840D	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	156.0	N/A	Grade Break?	N/A
			Yes	Ramp Width (in)	71.0	N/A	Grade Break Slope (%)	0.0
			Yes	Ramp Slope (%)	7.4	N/A	Grade Break XSlope (%)	0.0
			No	Ramp XSlope (%)	2.4			
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
Surveyor Notes:		N/A	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
PROW/ADA:		R304.5.3	N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No		Road Slope (%)	0.2
				X Walk 1 Direction	To N		Road X Slope (%)	3.2
				X Walk 1 Width (in)	N/A		Clear Space?	N/A
				X Walk 1 Slope (%)	0.2	N/A	Clear Space to XWalk (in)	N/A
				X Walk 1 X Slope (%)	3.2	N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
			N/A	Any Obstructions?	N/A			N/A
				Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	N/A	Curb Slope (%)	6.1
Street 1 Name		MATTHEWS FARM LN						
Stop Condition-Street 1		StopSign						
Street 2 Name		N/A						
Stop Condition-Street 2		N/A						
Total Cost:		\$ 1600.00						

