


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28374	Main Street: ARDREY_WOODS_DR	Cross Street: BURNSIDE_LN	Location:	N
ADA ID: 1296ABFB42AF	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 9
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

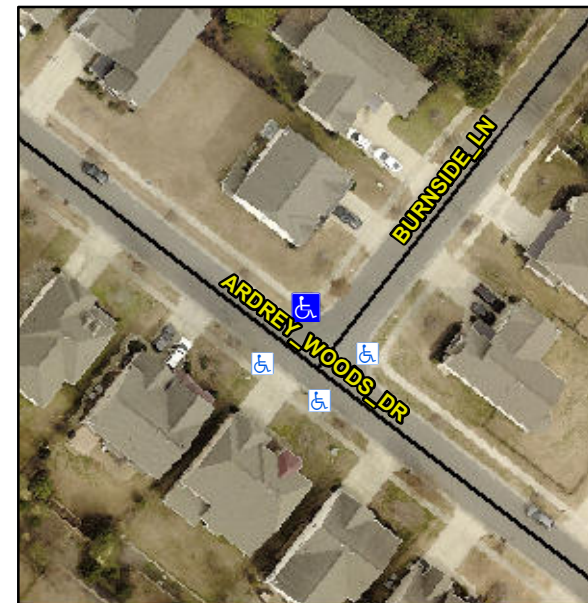

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.2, R304.5.4, R304.5.3

Street 1 Name **ARDREY WOODS DR**
 Stop Condition-Street 2 **None**
 Street 2 Name **BURNSIDE LN**
 Stop Condition-Street 1 **StopSign**

Total Cost: \$ **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	6.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.6	N/A	Flare Slope RT (%)	3.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
No	Landing Length (in)	44.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	36.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	10.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.5		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	2.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.4	N/A	Clear Space?	Yes
	Road X Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

