


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 54422	Main Street: LISMORE_LN	Cross Street: KILKENNY_DR	Location: W
ADA ID: 12AFA0FD72CD	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 20			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

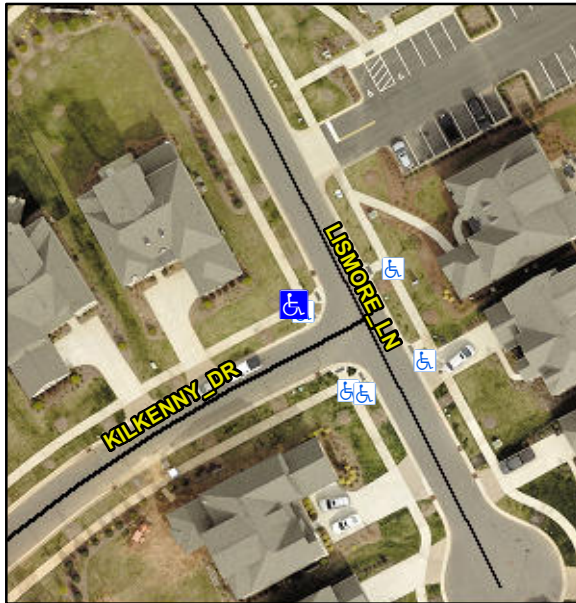

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

ROAD TO BE RESURFACED

PROW/ADA:

**Not Found, R302.7.2, R304.5.4,
R304.5.3**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	77.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	59.0	Yes	Grade Break Slope (%)	0.8
Yes	Ramp Slope (%)	1.0	Yes	Grade Break XSlope (%)	2.0
Yes	Ramp XSlope (%)	1.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.0	N/A	Flare Slope RT (%)	9.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.5	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.5	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	13.5
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.2
No	Gutter Lip Ht (in)	2.0	No	Gutter X Slope (%)	2.7
N/A	Painted X Walk1?	No		Road Slope (%)	3.2
	X Walk 1 Direction	To SE		Road X Slope (%)	1.3
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.3	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	10.4

