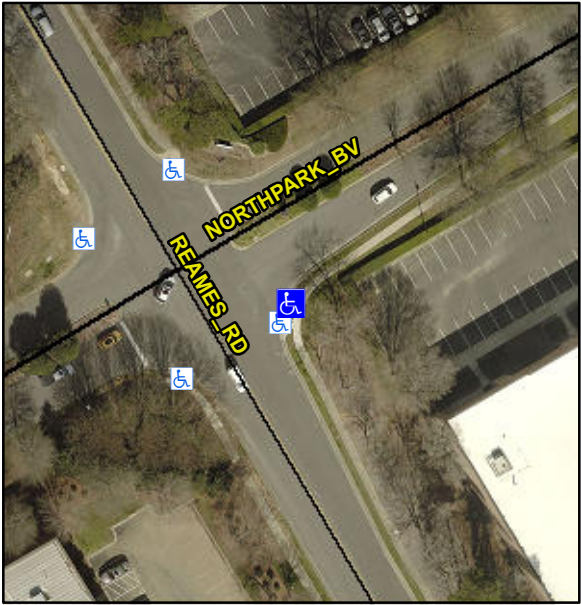


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5213	Main Street: NORTH PARK_BV	Cross Street: REAMES_RD	Location: SE
ADA ID: 12B5B7C68787	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0			

	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length LT (in)	56.0	N/A	Ramp Length RT (in)	56.0
			Yes	Ramp Width LT (in)	49.0	No	Ramp Width RT (in)	46.0
			Yes	Ramp Slope LT (%)	4.5	No	Ramp Slope RT (%)	8.9
			No	Ramp XSlope LT (%)	4.0	Yes	Ramp XSlope RT (%)	1.9
			N/A	Ramp Length (in)	54.0	No	Ramp Slope (%)	10.6
			Yes	Ramp Width (in)	55.5	No	Ramp XSlope (%)	7.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Surveyor Notes:</p> <p>LT RP < 5%</p> <p>PROW/ADA:</p> <p>R304.5.1, R304.2.2, R304.5.3, R304.3.2</p>			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To N		X Walk 2 Direction	To W
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p> <p>StopSign</p> <p>NORTH PARK BV</p> <p>None</p> <p>REAMES RD</p>				X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	4.3		X Walk 2 Slope (%)	4.5
				X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	2.8
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	4.4		Clear Space?	N/A
				Road X Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A
						N/A	Any Obstruction?	N/A
							Obstruction Type	N/A
						N/A	Storm Grate/Utility Hazard?	N/A
							Storm Grate/Utility Type	N/A
<p>Total Cost:</p> <p>\$ 3200.00</p>			Yes	Surface Condition? (G/P)	Good			
				Curb Slope (%)	1.7			

