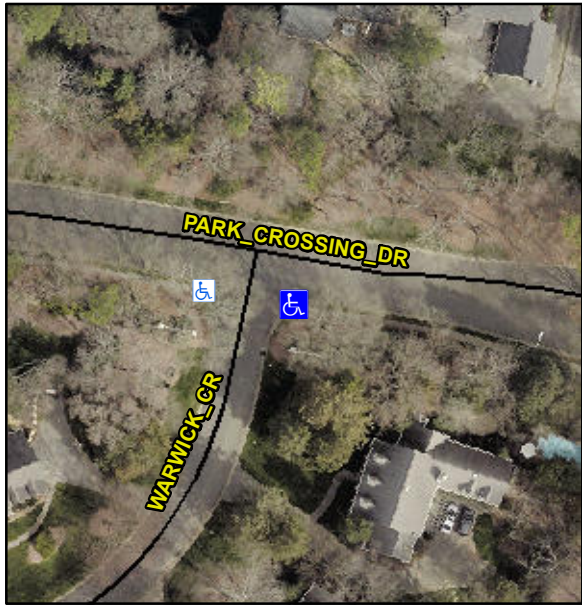


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                        |                               |                          |                        |
|------------------------|-------------------------------|--------------------------|------------------------|
| Intersection ID: 24557 | Main Street: PARK_CROSSING_DR | Cross Street: WARWICK_CR | Location: SE           |
| ADA ID: 12BE8DFD1EE5   | Ramp Type: PerpDiag           | Initial Pass/Fail: Fail  | Overall Compliance: No |
|                        |                               |                          | Severity Score: 13.75  |

| Codes/Mitigation Info/Possible Solution  |  |                    | Field Measurements/Component Compliance |                       |      |            |                             |      |
|--|--|--------------------|---|-----------------------|------|------------|-----------------------------|------|
|  | Possible Solutions:  |                    | Compliance                              | Description           | Data | Compliance | Description                 | Data |
|  | Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. |                    | N/A                                     | Ramp Length (in)      | 33.0 | No         | Ramp Slope (%)              | 8.5  |
|  |  |                    | Yes                                     | Ramp Width (in)       | 48.0 | No         | Ramp XSlope (%)             | 2.3  |
|  |  |                    | N/A                                     | Flare Type LT         | N/A  | N/A        | Flare Type RT               | N/A  |
|  |  |                    | N/A                                     | Flare Slope LT (%)    | N/A  | N/A        | Flare Slope RT (%)          | N/A  |
|  |  |                    | N/A                                     | Flare Traversable LT? | N/A  | N/A        | Flare Traversable RT?       | N/A  |
|  |  |                    | N/A                                     | Landing Length (in)   | N/A  | N/A        | DWS Provided?               | N/A  |
|  |  |                    | N/A                                     | Landing Width (in)    | N/A  | N/A        | DWS Contrast?               | N/A  |
|  |  |                    | N/A                                     | Landing Slope (%)     | N/A  | N/A        | DWS Length (in)             | N/A  |
|  |  |                    | N/A                                     | Landing X Slope (%)   | N/A  | N/A        | DWS Full Width?             | N/A  |
| Surveyor Notes:  |  | N/A                | N/A                                     | Landing Curb? (Y/N)   | N/A  | N/A        | DWS Offset (in)             | N/A  |
| PROW/ADA:  |  | R304.2.2, R304.5.3 | N/A                                     | Shared Landing?       | N/A  |            |                             |      |
|  |  |                    | N/A                                     | Gutter Ponding?       | N/A  | N/A        | Gutter Slope (%)            | N/A  |
|  |  |                    | N/A                                     | Gutter Lip Ht (in)    | N/A  | N/A        | Gutter X Slope (%)          | N/A  |
|  |  |                    | N/A                                     | Painted X Walk1?      | No   | N/A        | Painted X Walk2?            | No   |
|  |  |                    |   | X Walk 1 Direction    | To N |            | X Walk 2 Direction          | To W |
|  |  |                    | N/A                                     | X Walk 1 Width (in)   | N/A  | N/A        | X Walk 2 Width (in)         | N/A  |
|  |  |                    |   | X Walk 1 Slope (%)    | 0.8  |            | X Walk 2 Slope (%)          | 1.4  |
|  |  |                    |   | X Walk 1 X Slope (%)  | 1.8  |            | X Walk 2 X Slope (%)        | 0.8  |
|  |  |                    | N/A                                     | Ramp inside XWalk1?   | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|  |  |                    |   | Road Slope (%)        | 0.0  | N/A        | Clear Space?                | N/A  |
|  |  |                    |   | Road X Slope (%)      | 3.5  | N/A        | Clear Space to XWalk (in)   | N/A  |
|  |  |                    | N/A                                     | Any Obstructions?     | N/A  | N/A        | Storm Grate/Utility Hazard? | N/A  |
|  |  |                    |   | Obstruction Type      |      |            | Storm Grate/Utility Type    |      |
|  |  |                    |   |                       | N/A  |            |                             | N/A  |
|  |  |                    |   |                       |      | Yes        | Surface Condition? (G/P)    | Good |
| Total Cost:  |  | \$ 3200.00         |   |                       |      |            |                             |      |
| Street 1 Name  |  |                    | PARK CROSSING DR                        |                       |      |            |                             |      |
| Stop Condition-Street 2  |  |                    | None                                    |                       |      |            |                             |      |
| Street 2 Name  |  |                    | WARWICK CR                              |                       |      |            |                             |      |
| Stop Condition-Street 1  |  |                    | StopSign                                |                       |      |            |                             |      |

