


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 12809	Main Street: N_MCDOWELL_ST	Cross Street: E_7TH_ST	Location: S
ADA ID: 12DE34372103	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

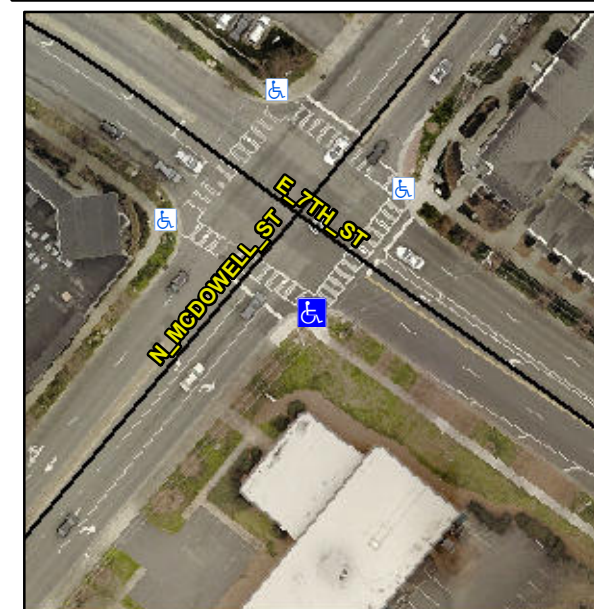

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.3, R304.2.3**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	89.0	Yes	Ramp Slope (%)	5.2
Yes	Ramp Width (in)	96.0	No	Ramp XSlope (%)	4.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	10.4	Yes	Flare Slope RT (%)	3.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	4.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	111.0	N/A	X Walk 2 Width (in)	110.0
	X Walk 1 Slope (%)	5.3		X Walk 2 Slope (%)	3.3
	X Walk 1 X Slope (%)	4.5		X Walk 2 X Slope (%)	4.0
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.1	N/A	Clear Space?	Yes
	Road X Slope (%)	6.5	Yes	Clear Space to XWalk (in)	96.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name E 7TH ST  
 Stop Condition-Street 2 Signal  
 Street 2 Name N MCDOWELL ST  
 Stop Condition-Street 1 Signal

