


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                            |   |                        |                    |
|---|----------------------------|---|------------------------|--------------------|
| Intersection ID: 9784                   | Main Street: FAIRMARKET_PL | Cross Street: THE_PLAZA                 | Location:              | NW                 |
| ADA ID: 12E611BADF24                    | Ramp Type: PerpDiag        | Initial Pass/Fail: Pass                 | Overall Compliance: No | Severity Score: 10 |
| Codes/Mitigation Info/Possible Solution |                            | Field Measurements/Component Compliance |                        |                    |

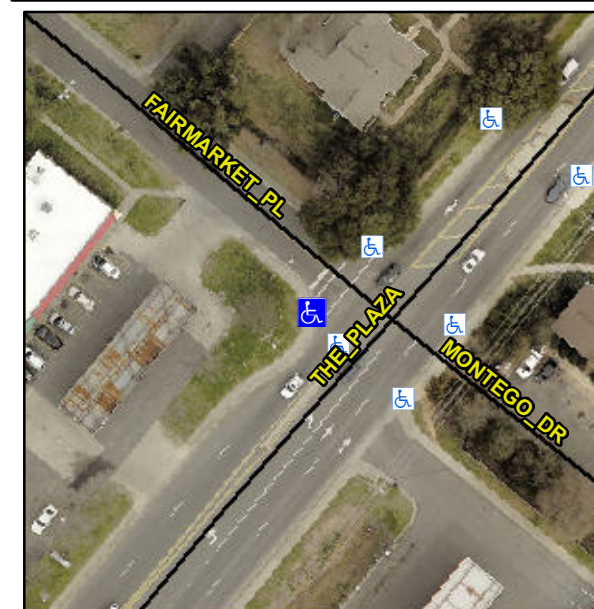

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2**

Total Cost: \$ 3200.00

| Compliance | Description           | Data   | Compliance | Description                 | Data  |
|------------|-----------------------|--------|------------|-----------------------------|-------|
| N/A        | Ramp Length (in)      | 61.0   | Yes        | Ramp Slope (%)              | 8.0   |
| Yes        | Ramp Width (in)       | 48.0   | Yes        | Ramp XSlope (%)             | 0.4   |
| N/A        | Flare Type LT         | Sloped | N/A        | Flare Type RT               | N/A   |
| N/A        | Flare Slope LT (%)    | 5.2    | Yes        | Flare Slope RT (%)          | 4.4   |
| N/A        | Flare Traversable LT? | Yes    | N/A        | Flare Traversable RT?       | Yes   |
| No         | Landing Length (in)   | N/A    | Yes        | DWS Provided?               | Yes   |
| No         | Landing Width (in)    | N/A    | Yes        | DWS Contrast?               | Yes   |
| No         | Landing Slope (%)     | N/A    | Yes        | DWS Length (in)             | 24.0  |
| No         | Landing X Slope (%)   | N/A    | Yes        | DWS Full Width?             | Yes   |
| N/A        | Landing Curb? (Y/N)   | No     | No         | DWS Offset (in)             | 2.5   |
| N/A        | Shared Landing?       | N/A    |            |                             |       |
| Yes        | Gutter Ponding?       | No     | Yes        | Gutter Slope (%)            | 0.4   |
| Yes        | Gutter Lip Ht (in)    | 0.0    | Yes        | Gutter X Slope (%)          | 0.1   |
| N/A        | Painted X Walk1?      | No     | N/A        | Painted X Walk2?            | Yes   |
|            | X Walk 1 Direction    | To SE  |            | X Walk 2 Direction          | To NE |
| N/A        | X Walk 1 Width (in)   | N/A    | N/A        | X Walk 2 Width (in)         | 110.0 |
|            | X Walk 1 Slope (%)    | 2.0    |            | X Walk 2 Slope (%)          | 0.3   |
|            | X Walk 1 X Slope (%)  | 1.8    |            | X Walk 2 X Slope (%)        | 2.7   |
| N/A        | Ramp inside XWalk1?   | N/A    | Yes        | Ramp inside XWalk2?         | Yes   |
|            | Road Slope (%)        | 0.1    | N/A        | Clear Space?                | Yes   |
|            | Road X Slope (%)      | 2.0    | N/A        | Clear Space to XWalk (in)   | N/A   |
| Yes        | Any Obstructions?     | No     | Yes        | Storm Grate/Utility Hazard? | No    |
|            | Obstruction Type      |        |            | Storm Grate/Utility Type    |       |
|            |                       | N/A    |            |                             | N/A   |
|            |                       |        | Yes        | Surface Condition? (G/P)    | Good  |

