

Access Compliance Report Public Rights-of-Way (Curb Ramps)



N/A 0.0 0.0

> N/A 0.0 N/A N/A N/A N/A N/A N/A

2.1

N/A

N/A

N/A

N/A Good

4.9

Intersection ID: 21296 Main Street: E_ARROWOOD_RD Cross Street: ENGLAND_ST Location: SE


ADA ID: 134DD97C2D7B Ramp Type: Directional1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A N/A

Curb Slope (%)

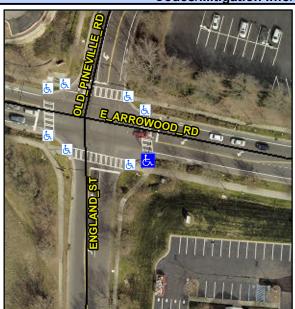

Street 1 Name E ARROWOOD RD
Stop Condition-Street 1 Signal
Street 2 Name N/A
Stop Condition-Street 2 N/A

russible solution			i leid Measurements/Component Compilance				
Possible Solutions:		Compliance Description		Data	Data Compliance Description		
Remove & Replace Enti	re Rar	mp.	N/A	Ramp Length (in)	84.0	N/A	Grade Break?
		•	Yes	Ramp Width (in)	73.0	N/A	Grade Break Slope (%)
			No	Ramp Slope (%)	10.5	N/A	Grade Break XSlope (%)
			No	Ramp XSlope (%)	2.2		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)
Surveyor Notes:			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?
N/A			N/A	Landing Length (in)	0.0	N/A	DWS Provided?
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?
			N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)
			N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?
PROW/ADA:			N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)
R304.2.2, R304.5.3			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)
•			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)
			N/A	Painted X Walk1?	Yes		Road Slope (%)
				X Walk 1 Direction	To N		Road X Slope (%)
				X Walk 1 Width (in)	113.0		Clear Space?
				X Walk 1 Slope (%)	5.3	N/A	Clear Space to XWalk (in)
				X Walk 1 X Slope (%)	2.1	N/A	Storm Grate/Utility Hazard?
			N/A	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type
			N/A	Any Obstructions?	N/A		
Total Cost:	\$	1600.00		Obstruction Type		Yes	Surface Condition? (G/P)





