

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53349	Main Street: SAPPHIRE_HILL_LN	Cross Street: N/A	Location: SE
ADA ID: 13ABEB6A357E	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

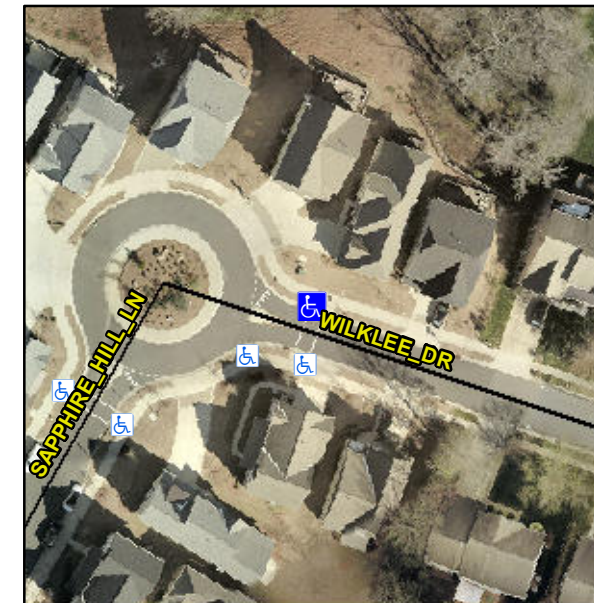

Possible Solutions:

Remove & Replace Landing.
Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.4, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	41.0	Yes	Ramp Slope (%)	6.3
Yes	Ramp Width (in)	62.0	Yes	Ramp XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.2	Yes	Flare Slope RT (%)	6.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	62.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	2.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.3
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.3
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	87.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.3		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1250.00

