


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 52800 Main Street: CHARMECK_PALISADES_DR Cross Street: CARNEGIE_BV Location: SE **Overall Compliance: No** ADA ID: 1491249382A6 Ramp Type: Directional1 Initial Pass/Fail: Fail **Severity Score:** 25

Codes/Mitigation Info/Possible Solution

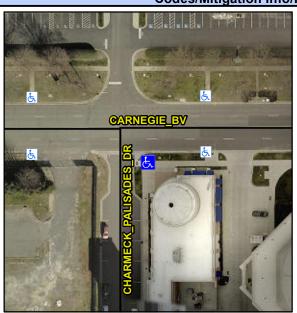

Street 1 Name	CHARMECK PALISADES DR
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: R304.2.2, R304.5.3

Total Cost:	\$ 1600.00

Field Measurements/Component Compliance								
Compli	ance Description	Data	Compl	iance Description	Data			
N/A	Ramp Length (in)	69.0	N/A	Grade Break?	N/A			
Yes	Ramp Width (in)	63.0	N/A	Grade Break Slope (%)	0.0			
No	Ramp Slope (%)	9.5	N/A	Grade Break XSlope (%)	0.0			
No	Ramp XSlope (%)	5.8						
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0			
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A			
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A			
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A			
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A			
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A			
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A			
N/A	Painted X Walk1?	No		Road Slope (%)	0.7			
	X Walk 1 Direction	To W		Road X Slope (%)	1.9			
	X Walk 1 Width (in)	N/A		Clear Space?	N/A			
	X Walk 1 Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A			
	X Walk 1 X Slope (%)	1.9	N/A	Storm Grate/Utility Hazard?	N/A			
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type				
N/A	Any Obstructions?	N/A			N/A			
	Obstruction Type		Yes	Surface Condition? (G/P)	Good			
		N/A	N/A	Curb Slope (%)	0.5			





