

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13959	Main Street: CLEVELAND_AV	Cross Street: E_PARK_AV	Location: N
ADA ID: 14A304464CC7	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 20.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

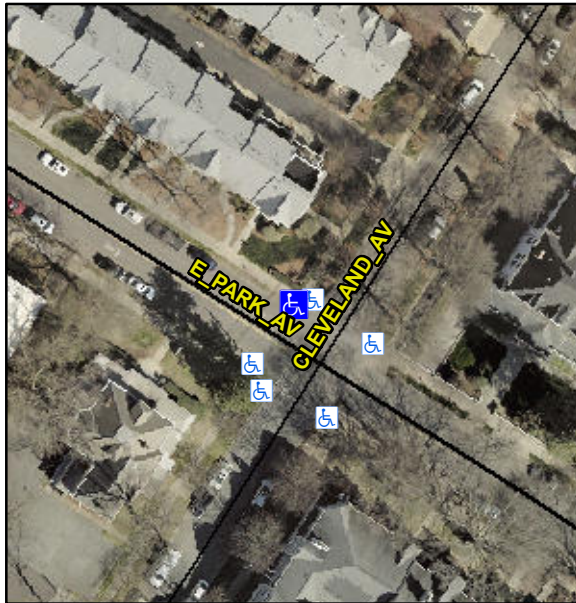

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.3, R305.2, R302.7.2

Street 1 Name	E PARK AV
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ **1850.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	36.0	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	15.3	Yes	Flare Slope RT (%)	7.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.9
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

