


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                              |                                         |                        |
|-----------------------------------------|------------------------------|-----------------------------------------|------------------------|
| Intersection ID: 44786                  | Main Street: AYRSLEY_TOWN_BV | Cross Street: KINGS_PARADE_BV           | Location: SE           |
| ADA ID: 1514ABEA8350                    | Ramp Type: Perp              | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Severity Score: 13.75                   |                              |                                         |                        |
| Codes/Mitigation Info/Possible Solution |                              | Field Measurements/Component Compliance |                        |

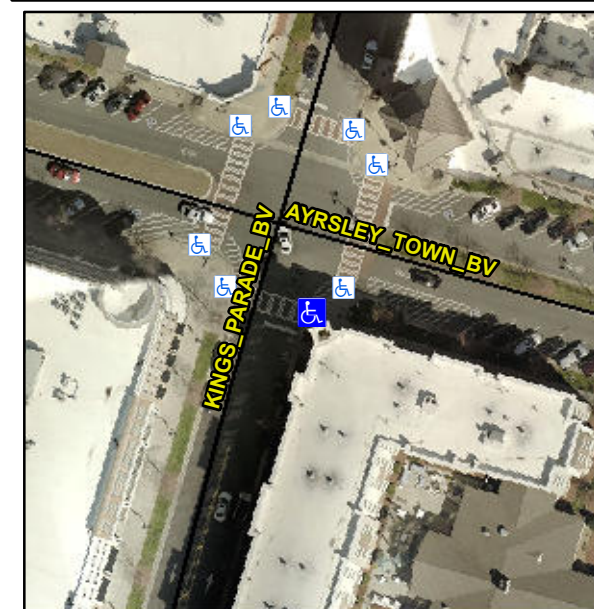

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2, R304.5.3**

Total Cost: \$ 1850.00

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 91.0  | No         | Ramp Slope (%)              | 9.2  |
| Yes        | Ramp Width (in)       | 48.0  | No         | Ramp XSlope (%)             | 3.2  |
| N/A        | Flare Type LT         | N/A   | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)   | N/A   | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)    | N/A   | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)     | N/A   | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)   | N/A   | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)   | N/A   | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | N/A   |            |                             |      |
| N/A        | Gutter Ponding?       | N/A   | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)    | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?      | Yes   | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction    | To NW |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)   | 110.0 | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 3.9   |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%)  | 3.5   |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?   | Yes   | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | N/A   | N/A        | Clear Space?                | N/A  |
|            | Road X Slope (%)      | N/A   | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?     | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type      |       |            | Storm Grate/Utility Type    |      |
|            |                       | N/A   |            |                             | N/A  |
|            |                       |       | Yes        | Surface Condition? (G/P)    | Good |

Street 1 Name **KINGS PARADE BV**

Stop Condition-Street 2 **StopSign**

Street 2 Name **N/A**

Stop Condition-Street 1 **N/A**

