

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|----------------------------|-----------------------------|------------------------|
| Intersection ID: 14469 | Main Street: E_MOREHEAD_ST | Cross Street: KENILWORTH_AV | Location: E |
| ADA ID: 1535C2BB836B | Ramp Type: BlendTrans1 | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | Severity Score: 0 | |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

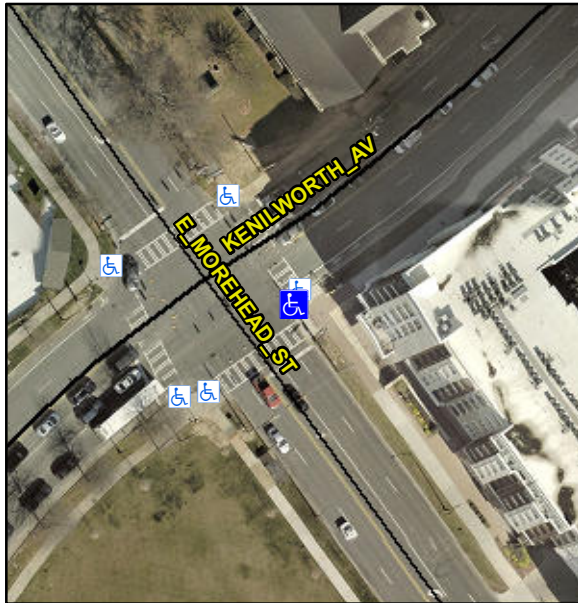

Possible Solutions:

Remove & Replace Curb Slope and Extend Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found

| | |
|-------------------------|----------------------|
| Street 1 Name | E MOREHEAD ST |
| Stop Condition-Street 1 | Signal |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

Total Cost: \$ **2000.00**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|--------|------------|-----------------------------|--------|
| N/A | Ramp Length (in) | 60.0 | Yes | BlendTrans Slope (%) | 3.1 |
| Yes | Ramp Width (in) | 60.0 | Yes | BlendTrans XSlope (%) | 0.9 |
| N/A | Flare Type LT | Sloped | N/A | Flare Type RT | Sloped |
| Yes | Flare Slope LT (%) | 4.9 | N/A | Flare Slope RT (%) | 6.2 |
| N/A | Flare Traversable LT? | Yes | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 48.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 60.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.3 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 0.1 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 2.0 |
| N/A | Shared Landing? | No | | | |
| Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 1.3 |
| Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 0.3 |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | N/A |
| | X Walk 1 Width (in) | 112.0 | | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 5.6 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 0.6 | | X Walk 2 X Slope (%) | N/A |
| Yes | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 0.6 | | Clear Space? | Yes |
| | Road X Slope (%) | 5.6 | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | No | Curb Slope (%) | 14.0 |

