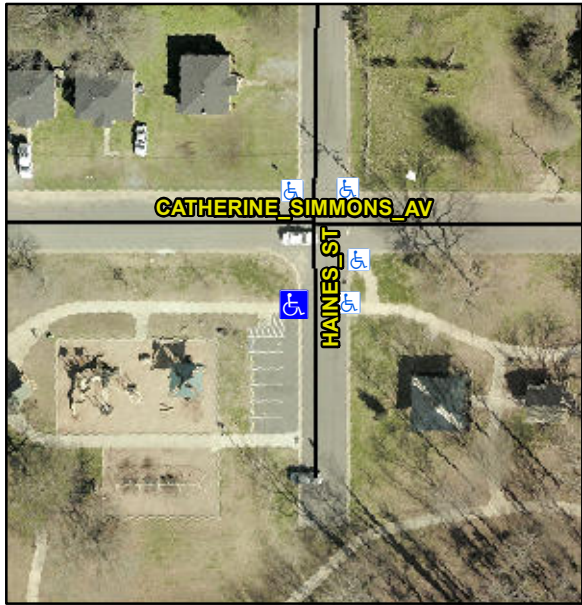
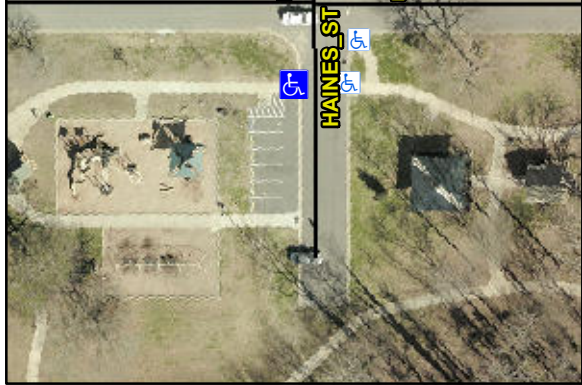


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8285	Main Street: CATHERINE_SIMMONS_AV	Cross Street: HAINES_ST	Location: S
ADA ID: 1554A0254F99	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 15			

	Possible Solutions:							
	Remove & Replace Entire Ramp.							
	Surveyor Notes:							
	N/A							
	PROW/ADA:							
	Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R302.7.2							
	Street 1 Name	HAINES ST	Compliance	Description	Data	Compliance	Description	Data
	Stop Condition-Street 2	StopSign	N/A	Ramp Length (in)	16.5	Yes	Ramp Slope (%)	5.2
	Street 2 Name	N/A	Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	2.0
	Stop Condition-Street 1	N/A	N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	4.0	N/A	Flare Slope RT (%)	9.3	
		N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No	
		Yes	Landing Length (in)	80.5	Yes	DWS Provided?	Yes	
		Yes	Landing Width (in)	72.5	Yes	DWS Contrast?	Yes	
		No	Landing Slope (%)	2.1	Yes	DWS Length (in)	24.0	
		No	Landing X Slope (%)	2.8	Yes	DWS Full Width?	Yes	
		N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0	
		N/A	Shared Landing?	No				
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2	
		No	Gutter Lip Ht (in)	2.0	Yes	Gutter X Slope (%)	0.6	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
			X Walk 1 Direction	To E		X Walk 2 Direction	N/A	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	N/A	N/A	Clear Space?	Yes	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A		N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	1850.00					

