

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30327	Main Street: FLYING_SCOTSMAN_DR	Cross Street: STOURBRIDGE_LION_DR	Location: N
ADA ID: 156F17450EB4	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

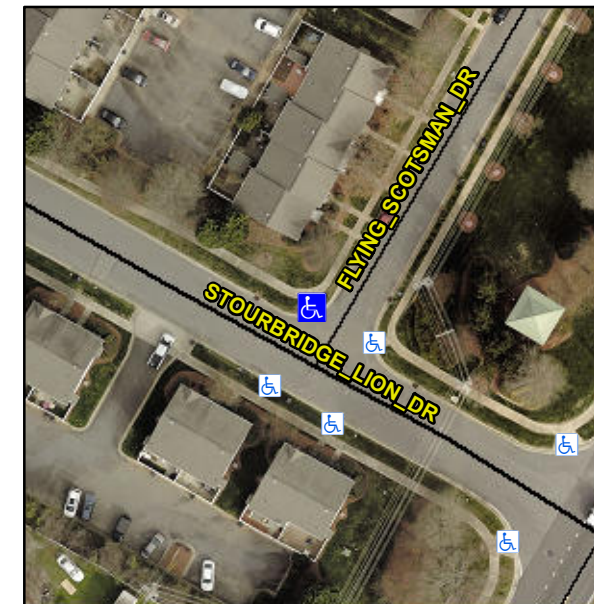

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

CURB LIP 1.0

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	93.0	Yes	BlendTrans Slope (%)	3.4
Yes	Ramp Width (in)	54.0	No	BlendTrans XSlope (%)	3.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	2.7	N/A	Flare Slope RT (%)	10.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	60.0	No	DWS Provided?	No
No	Landing Width (in)	40.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.5	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	4.5
	X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	2.7
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.0		Clear Space?	Yes
	Road X Slope (%)	2.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	15.0

