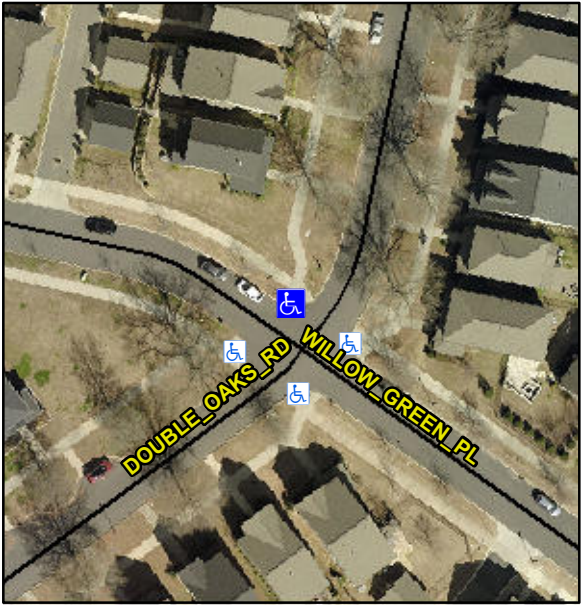


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 52444	Main Street: WILLOW_GREEN_PL	Cross Street: DOUBLE_OAKS_RD	Location:	N
ADA ID: 15FF1D3C5CB7	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>No</b>	<b>Ramp Length (in)</b>	<b>101.5</b>	<b>No</b>
			<b>Yes</b>	<b>Ramp Width (in)</b>	<b>71.5</b>	<b>No</b>
			<b>N/A</b>	<b>Flare Type LT</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Flare Slope LT (%)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Flare Traversable LT?</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Landing Length (in)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Landing Width (in)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Landing Slope (%)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Landing X Slope (%)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Landing Curb? (Y/N)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Shared Landing?</b>	<b>N/A</b>	
			<b>N/A</b>	<b>Gutter Ponding?</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Gutter Lip Ht (in)</b>	<b>N/A</b>	<b>N/A</b>
			<b>N/A</b>	<b>Painted X Walk1?</b>	<b>No</b>	<b>N/A</b>
				<b>X Walk 1 Direction</b>	<b>To SW</b>	<b>N/A</b>
			<b>N/A</b>	<b>X Walk 1 Width (in)</b>	<b>N/A</b>	<b>N/A</b>
				<b>X Walk 1 Slope (%)</b>	<b>1.3</b>	<b>N/A</b>
				<b>X Walk 1 X Slope (%)</b>	<b>6.1</b>	<b>N/A</b>
			<b>N/A</b>	<b>Ramp inside XWalk1?</b>	<b>N/A</b>	<b>N/A</b>
				<b>Road Slope (%)</b>	<b>6.4</b>	<b>N/A</b>
				<b>Road X Slope (%)</b>	<b>3.6</b>	<b>N/A</b>
			<b>N/A</b>	<b>Any Obstructions?</b>	<b>N/A</b>	<b>N/A</b>
				<b>Obstruction Type</b>		<b>N/A</b>
					<b>N/A</b>	<b>N/A</b>
			<b>Yes</b>	<b>Surface Condition? (G/P)</b>		<b>Good</b>

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.2, R304.5.3**

Total Cost:

**\$ 3200.00**

Street 1 Name **WILLOW GREEN PL**  
 Stop Condition-Street 2 **StopSign**  
 Street 2 Name **DOUBLE OAKS RD**  
 Stop Condition-Street 1 **None**

