


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13302	Main Street: E_4TH_ST	Cross Street: E_JOHN_BELK_RA	Location: E
ADA ID: 1604A79CDBB5	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 0.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

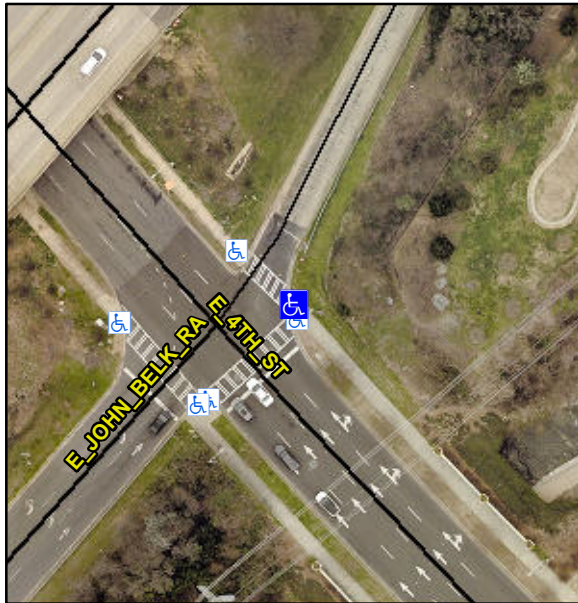

Possible Solutions:

**Remove & Replace Entire Ramp.
Restripe Crosswalk.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R207.1

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	48.0	Yes	Grade Break Slope (%)	4.7
Yes	Ramp Slope (%)	5.7	No	Grade Break XSlope (%)	6.8
No	Ramp XSlope (%)	3.2			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	12.1	N/A	Flare Slope RT (%)	9.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	62.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	99.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	58.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	Yes		Road Slope (%)	1.4
	X Walk 1 Direction	To NW		Road X Slope (%)	1.6
	X Walk 1 Width (in)	110.0		Clear Space?	Yes
	X Walk 1 Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.6	Yes	Storm Grate/Utility Hazard?	No
No	Ramp inside XWalk1?	No		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.3

Total Cost: \$ 1800.00

