


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 53018	Main Street: STEEL_HOUSE_BV	Cross Street: SPENCER_ST	Location: NW
ADA ID: 165BEC9A2831	Ramp Type: BlendTrans2	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 17.5			

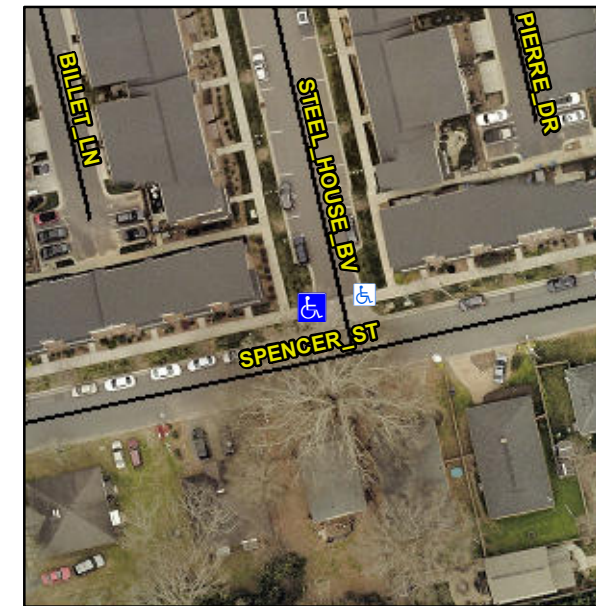

Possible Solutions:

**Install Detectable Warning System.  
Grind Gutter Lip.**

Surveyor Notes:

**COLLECTED WITH ULIP**

PROW/ADA:

**R305, R302.7.2**

Total Cost: \$ 435.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.5	Yes	BlendTrans Slope (%)	1.7
Yes	Ramp Width (in)	71.0	Yes	BlendTrans XSlope (%)	1.6
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	No	DWS Provided?	No
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	No
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5		Clear Space?	Yes
	Road X Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	0.4

Street 1 Name STEEL HOUSE BV  
 Stop Condition-Street 1 StopSign  
 Street 2 Name N/A  
 Stop Condition-Street 2 N/A

