


# Access Compliance Report

## Public Rights-of-Way (Curb Ramps)

Intersection ID: 2587	Main Street: KILMARTIN_LN	Cross Street: MCCHESENEY_DR	Location: S
ADA ID: 16C633AB00D3	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 17.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		N/A	Ramp Length (in)	46.0	Yes	Ramp Slope (%)	6.5
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.5
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	1.4	Yes	Flare Slope RT (%)	3.8
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			Yes	Landing Length (in)	48.0	No	DWS Provided?	No
			Yes	Landing Width (in)	55.0	N/A	DWS Contrast?	No
			Yes	Landing Slope (%)	0.4	N/A	DWS Length (in)	N/A
			No	Landing X Slope (%)	4.0	N/A	DWS Full Width?	No
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
PROW/ADA:		Not Found, R304.5.3, R305, R302.7.2	N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
			No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.1
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To E		X Walk 2 Direction	To N
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	2.6
				X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	1.2
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
				Road Slope (%)	2.0	N/A	Clear Space?	Yes
				Road X Slope (%)	3.0	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
				Obstruction Type			Storm Grate/Utility Type	
					N/A			N/A
						Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3950.00						

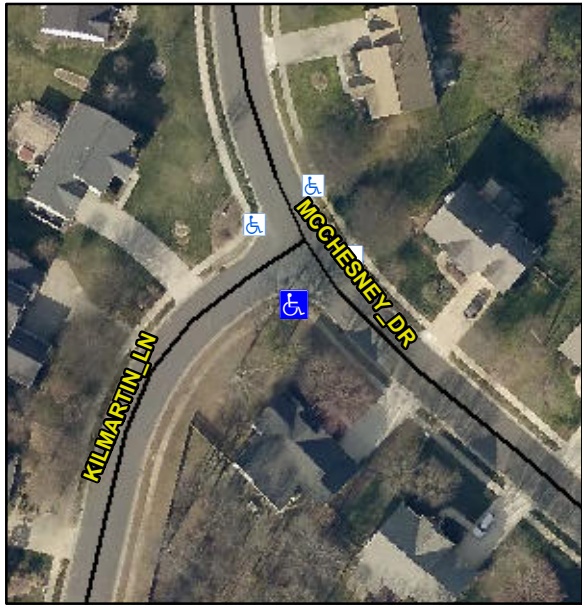