

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 42988	Main Street: UNIVERSITY_CITY_BV	Cross Street: UNIVERSITY_WALK_CR	Location: S
ADA ID: 16D82B0F0DA9	Ramp Type: BlendTrans1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 10	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

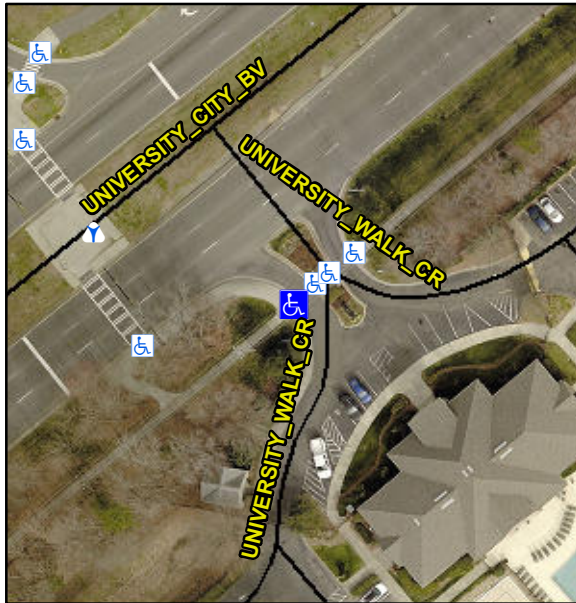

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:

**RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R302.7.2, R304.5.4**

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	61.0	Yes	BlendTrans Slope (%)	0.2
No	Ramp Width (in)	47.5	Yes	BlendTrans XSlope (%)	3.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
No	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	N/A	No	Gutter Slope (%)	N/A
No	Gutter Lip Ht (in)	N/A	No	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	57.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	N/A	Yes	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	11.5

