

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10022596	Main Street: CARMEL_RD	Cross Street: N/A	Location: SW
ADA ID: 17A18276D4C5	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

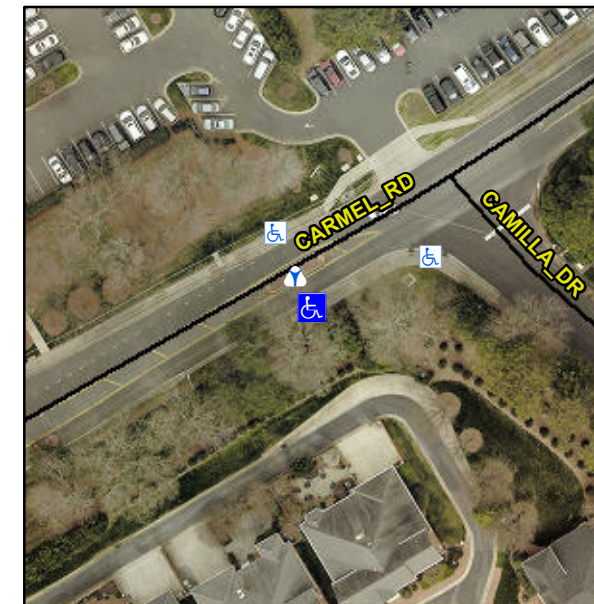

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.3.2, R304.5.3**

Street 1 Name	<b>CARMEL RD</b>
Stop Condition-Street 1	<b>None</b>
Street 2 Name	<b>N/A</b>
Stop Condition-Street 2	<b>N/A</b>

Total Cost: \$ **1600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	<b>69.0</b>	N/A	Ramp Length RT (in)	<b>72.0</b>
Yes	Ramp Width LT (in)	<b>53.0</b>	Yes	Ramp Width RT (in)	<b>53.0</b>
Yes	Ramp Slope LT (%)	<b>6.5</b>	No	Ramp Slope RT (%)	<b>8.6</b>
Yes	Ramp XSlope LT (%)	<b>1.1</b>	No	Ramp XSlope RT (%)	<b>2.5</b>
N/A	Landing Length (in)	<b>N/A</b>	N/A	DWS Provided?	<b>N/A</b>
N/A	Landing Width (in)	<b>N/A</b>	N/A	DWS Contrast?	<b>N/A</b>
N/A	Landing Slope (%)	<b>N/A</b>	N/A	DWS Length (in)	<b>N/A</b>
N/A	Landing X Slope (%)	<b>N/A</b>	N/A	DWS Full Width?	<b>N/A</b>
N/A	Landing Curb? (Y/N)	<b>N/A</b>	N/A	DWS Offset (in)	<b>N/A</b>
N/A	Shared Landing?	<b>N/A</b>			
N/A	Gutter Ponding?	<b>N/A</b>	N/A	Gutter Slope (%)	<b>N/A</b>
N/A	Gutter Lip Ht (in)	<b>N/A</b>	N/A	Gutter X Slope (%)	<b>N/A</b>
N/A	Painted X Walk1?	<b>No</b>	N/A	Painted X Walk2?	<b>N/A</b>
	X Walk 1 Direction	<b>To NW</b>		X Walk 2 Direction	<b>N/A</b>
N/A	X Walk 1 Width (in)	<b>N/A</b>	N/A	X Walk 2 Width (in)	<b>N/A</b>
	X Walk 1 Slope (%)	<b>0.4</b>		X Walk 2 Slope (%)	<b>N/A</b>
	X Walk 1 X Slope (%)	<b>0.3</b>		X Walk 2 X Slope (%)	<b>N/A</b>
N/A	Ramp inside XWalk1?	<b>N/A</b>	N/A	Ramp inside XWalk2?	<b>N/A</b>
	Road Slope (%)	<b>N/A</b>	N/A	Clear Space?	<b>N/A</b>
	Road X Slope (%)	<b>N/A</b>	N/A	Clear Space to XWalk (in)	<b>N/A</b>
N/A	Any Obstructions?	<b>N/A</b>	N/A	Storm Grate/Utility Hazard?	<b>N/A</b>
	Obstruction Type			Storm Grate/Utility Type	
		<b>N/A</b>			<b>N/A</b>
			Yes	Surface Condition? (G/P)	<b>Good</b>
			N/A	Curb Slope (%)	<b>8.1</b>

