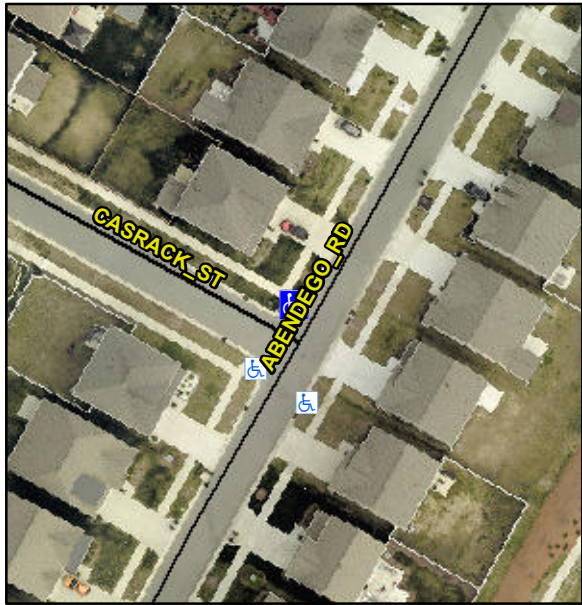


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53978	Main Street: CASRACK_ST	Cross Street: ABENDEGO_RD	Location:	N
ADA ID: 17C372735371	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 20

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 Street 1 Name CASRACK ST Stop Condition-Street 2 StopSign Street 2 Name ABENDEGO RD Stop Condition-Street 1 None	Possible Solutions:		Compliance			Compliance		
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.		Description			Description		
			Data			Data		
			N/A			Yes		
			Ramp Length (in)			Ramp Slope (%)		
			98.0			7.3		
			Yes			Yes		
			Ramp Width (in)			Ramp XSlope (%)		
			48.0			1.4		
			N/A			N/A		
		Flare Type LT			Sloped			
		N/A			N/A			
		Flare Slope LT (%)			6.3			
		N/A			N/A			
		Flare Traversable LT?			No			
		N/A			N/A			
		Flare Slope RT (%)			11.2			
		Yes			Yes			
		Landing Length (in)			68.0			
		No			Yes			
		Landing Width (in)			29.0			
		Yes			Yes			
		Landing Slope (%)			0.7			
		No			Yes			
		Landing X Slope (%)			2.3			
		N/A			No			
		Landing Curb? (Y/N)			No			
		N/A			No			
		Shared Landing?			No			
		Yes			No			
		Gutter Ponding?			No			
		No			No			
		Gutter Lip Ht (in)			1.0			
		N/A			N/A			
		Painted X Walk1?			No			
		X Walk 1 Direction			To W			
		N/A			N/A			
		X Walk 1 Width (in)			N/A			
		X Walk 1 Slope (%)			1.7			
		X Walk 1 X Slope (%)			2.3			
		N/A			N/A			
		Ramp inside XWalk1?			N/A			
		Road Slope (%)			3.0			
		Road X Slope (%)			4.0			
		Yes			Yes			
		Any Obstructions?			No			
		Obstruction Type			N/A			
					N/A			
					Yes			
					Surface Condition? (G/P)			
					Good			

Total Cost: \$ 3950.00

