

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52449	Main Street: TRANQUIL_OAK_PL	Cross Street: PAT_GARRETT_ST	Location: NW
ADA ID: 17C5AC952EFB	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

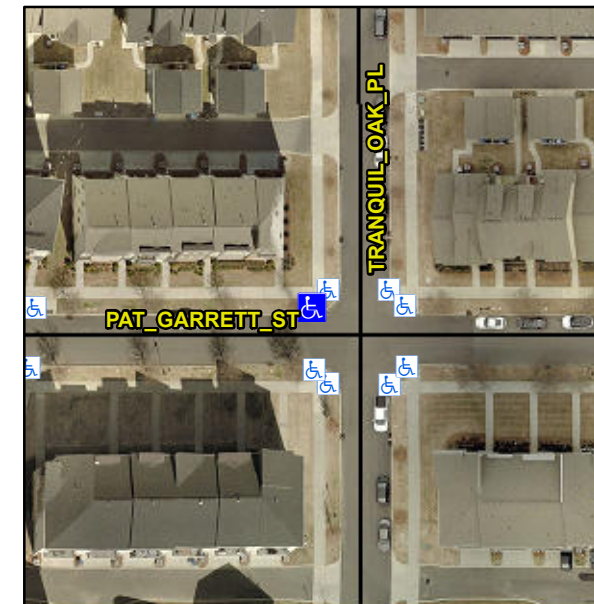

Possible Solutions:

**Remove & Replace Entire Ramp.
Grind Gutter Lip.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.2, R305.1.4, R305.2, R302.7.2

Total Cost:

\$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	67.0	No	Grade Break?	No
Yes	Ramp Width (in)	66.0	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	7.8	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	1.8			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	85.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	77.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.1	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	3.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	3.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.3
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	No		Road Slope (%)	1.2
	X Walk 1 Direction	To S		Road X Slope (%)	2.7
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.7	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	1.6

Street 1 Name PAT GARRETT ST

Stop Condition-Street 1 None

Street 2 Name N/A

Stop Condition-Street 2 N/A

