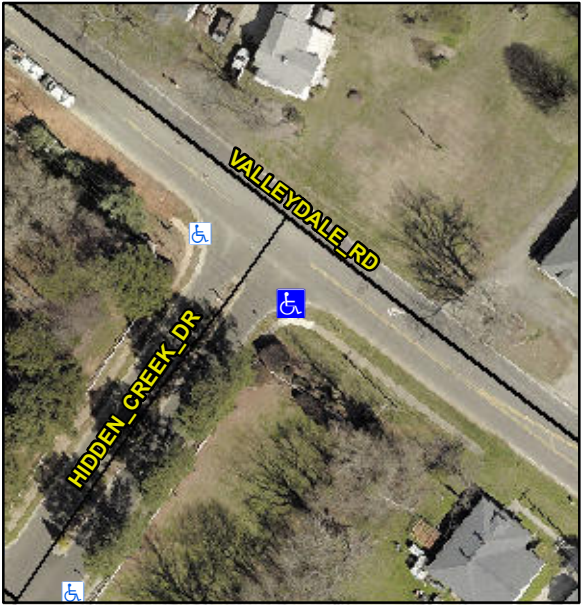


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 30183	Main Street: HIDDEN_CREEK_DR	Cross Street: VALLEYDALE_RD	Location: S
ADA ID: 181654741775	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes:						
	N/A						
	PROW/ADA:						
	R304.2.2						
	Street 1 Name	HIDDEN CREEK DR					
	Stop Condition-Street 2	StopSign					
	Street 2 Name	N/A					
	Stop Condition-Street 1	N/A					
Total Cost:		\$	1850.00				
				Compliance	Description	Data	Compliance
						Description	Data
				N/A	Ramp Length (in)	53.0	No
				Yes	Ramp Width (in)	55.0	Yes
				N/A	Flare Type LT	N/A	N/A
				N/A	Flare Slope LT (%)	N/A	N/A
				N/A	Flare Traversable LT?	N/A	N/A
				N/A	Flare Traversable RT?	N/A	N/A
				N/A	Landing Length (in)	N/A	N/A
				N/A	Landing Width (in)	N/A	N/A
				N/A	Landing Slope (%)	N/A	N/A
				N/A	Landing X Slope (%)	N/A	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A
				N/A	Shared Landing?	N/A	N/A
				N/A	Gutter Ponding?	N/A	N/A
				N/A	Gutter Lip Ht (in)	0.5	N/A
				N/A	Painted X Walk1?	No	N/A
					X Walk 1 Direction	To NW	
				N/A	X Walk 1 Width (in)	N/A	N/A
					X Walk 1 Slope (%)	1.2	
					X Walk 1 X Slope (%)	0.4	
				N/A	Ramp inside XWalk1?	N/A	N/A
					Ramp inside XWalk2?	N/A	
					Road Slope (%)	N/A	
					Road X Slope (%)	N/A	
				N/A	Clear Space?	N/A	N/A
					Clear Space to XWalk (in)	N/A	
				N/A	Storm Grate/Utility Hazard?	N/A	N/A
					Storm Grate/Utility Type		
				N/A			N/A
				Yes	Surface Condition? (G/P)		Good

