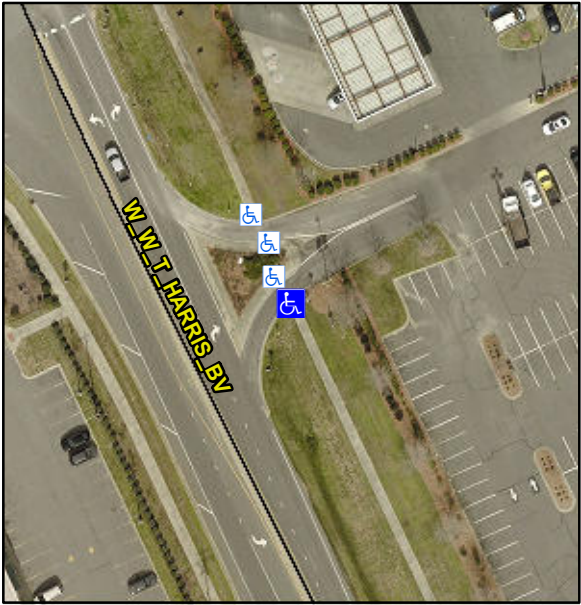


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10040796	Main Street: W W T HARRIS BV	Cross Street: N/A	Location: SE
ADA ID: 187FE0C0CEDC	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10.25			

	Possible Solutions:						
	Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	40.0	No	Grade Break?	No
	Remove & Replace Gutter.	Yes	Ramp Width (in)	60.0	N/A	Grade Break Slope (%)	N/A
		Yes	Ramp Slope (%)	1.3	N/A	Grade Break XSlope (%)	N/A
		No	Ramp XSlope (%)	2.9			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:	Yes	Landing Length (in)	60.0	No	DWS Provided?	No
	N/A	Yes	Landing Width (in)	60.0	N/A	DWS Contrast?	No
<p>PROW/ADA:</p> <p><b>R304.5.3, R304.2.2-Perp, R304.3.2-Para, R304.5.2, R305</b></p>		No	Landing Slope (%)	2.6	N/A	DWS Length (in)	N/A
		Yes	Landing X Slope (%)	0.3	N/A	DWS Full Width?	No
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
		N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
		Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9
		N/A	Painted X Walk1?	No		Road Slope (%)	1.1
			X Walk 1 Direction	To N		Road X Slope (%)	2.1
			X Walk 1 Width (in)	N/A		Clear Space?	Yes
			X Walk 1 Slope (%)	1.1	N/A	Clear Space to XWalk (in)	N/A
<p>Total Cost: \$ 2350.00</p>			X Walk 1 X Slope (%)	2.1	Yes	Storm Grate/Utility Hazard?	No
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
		Yes	Any Obstructions?	No			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	5.1

