




Access Compliance Report Public Rights-of-Way (Curb Ramps)

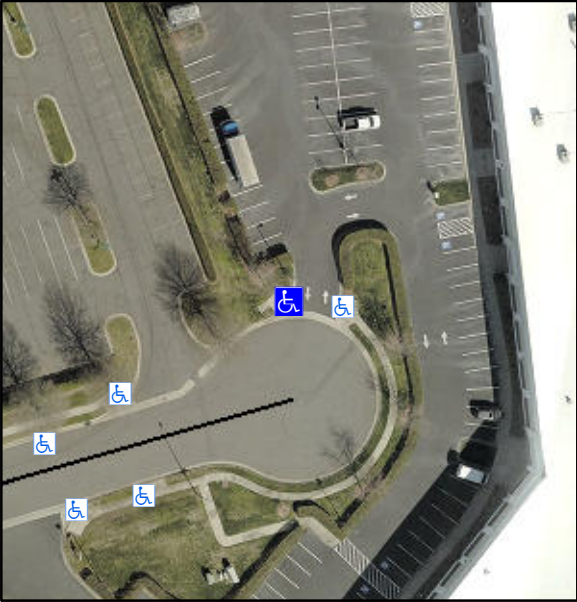

Intersection ID: 10041624	Main Street: WHITEHALL EXECUTIVE CENTER DR	Access Street: N/A	Location: W
ADA ID: 1890A86E34C1	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length LT (in)	38.0	
			Yes	Ramp Width LT (in)	48.0	
			Yes	Ramp Slope LT (%)	1.2	
			Yes	Ramp XSlope LT (%)	0.9	
			N/A	Ramp Length (in)	48.0	
			Yes	Ramp Width (in)	48.0	
	Surveyor Notes:		N/A	Flare Type LT	N/A	
	LT RP < 5%		N/A	Flare Slope LT (%)	N/A	
			N/A	Flare Traversable LT?	N/A	
	PROW/ADA:		N/A	Landing Length (in)	N/A	
	R304.5.3		N/A	Landing Width (in)	N/A	
			N/A	Landing Slope (%)	N/A	
			N/A	Landing X Slope (%)	N/A	
			N/A	Landing Curb? (Y/N)	N/A	
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	
			N/A	Gutter Lip Ht (in)	N/A	
			N/A	Painted X Walk1?	No	
				X Walk 1 Direction	To E	
Street 1 Name	StopSign			X Walk 1 Width (in)	N/A	
Stop Condition-Street 1	ENTRANCE			X Walk 1 Slope (%)	1.8	
Street 2 Name	N/A			X Walk 1 X Slope (%)	3.7	
Stop Condition-Street 2	N/A			Ramp inside XWalk1?	N/A	
Total Cost:		\$ 1800.00	N/A	Road Slope (%)	N/A	
				Road X Slope (%)	N/A	
				Clear Space?	N/A	
				Clear Space to XWalk (in)	N/A	
				Any Obstruction?	N/A	
				Obstruction Type		
						N/A
			N/A	Storm Grate/Utility Hazard?	N/A	
				Storm Grate/Utility Type		
						N/A
			Yes	Surface Condition? (G/P)	Good	
				Curb Slope (%)	2.4	

