

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

61.0

60.0

5.2

0.6

3.0

0.5

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Main Street: REA RD Cross Street: N/A Intersection ID: 10035551 Location: SE Initial Pass/Fail: Fail **Overall Compliance: No** 10 ADA ID: 18B64814CE0E Ramp Type: Combination1 **Severity Score:**

Compliance Description

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Landing Length (in)

Landing Width (in)

Landing Slope (%)

Landing X Slope (%)

Landing Curb? (Y/N)

Shared Landing?

Gutter Ponding?

Flare Traversable LT?

Flare Type LT

Ramp XSlope LT (%)

N/A

Yes

Yes

No

N/A

No

N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

Yes

Yes

Yes

Yes

N/A

N/A

N/A

N/A

N/A

N/A

N/A

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Flare Traversable RT?

Flare Type RT

Ramp XSlope RT (%)

Data

54.0

60.0

4.8

2.1

60.0

46.0

N/A

N/A

N/A

N/A

N/A


N/A

N/A

N/A

N/A

N/A N/A

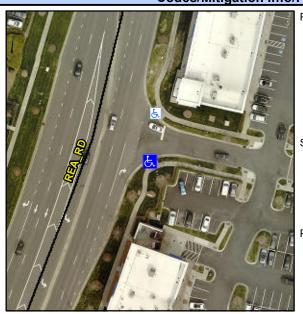

Street 1 Name StopSign **ENTRANCE** Stop Condition-Street 1 Street 2 Name N/A Stop Condition-Street 2 N/A Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1, R304.5.3





Total Cost:



1800.00

	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
		X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
		X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A
		X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	N/A
)	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	N/A		Clear Space?	N/A
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		al Way		N/A	Any Obstruction?	N/A
SPO	4				Obstruction Type	
	in term					N/A
	-			N/A	Storm Grate/Utility Hazard?	N/A
					Storm Grate/Utility Type	WA.
100						N/A
1				Yes	Surface Condition? (G/P)	Good
	1				Curb Slope (%)	12.0