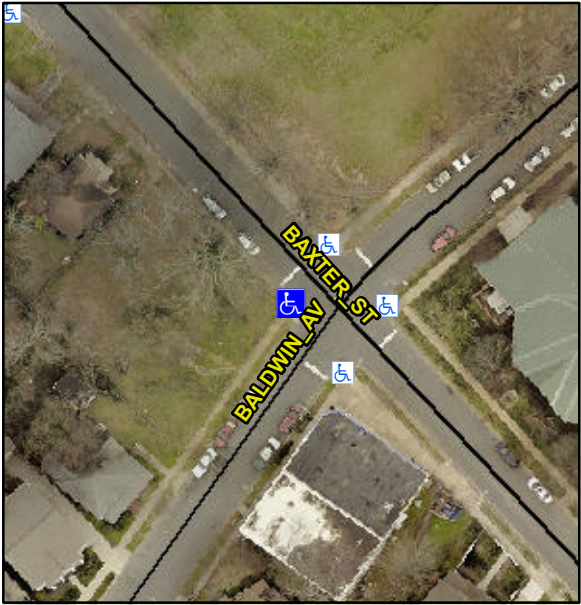


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14401	Main Street: BAXTER_ST	Cross Street: BALDWIN_AV	Location: W
ADA ID: 192D02F0DA8B	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 1.25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	95.0
			N/A	Ramp Width (in)	51.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.3</p>			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Gutter X Slope (%)	N/A
			No	Painted X Walk1?	No
			To SE	X Walk 2 Direction	To NE
			N/A	X Walk 2 Width (in)	N/A
			3.7	X Walk 2 Slope (%)	3.0
			1.2	X Walk 2 X Slope (%)	1.6
			N/A	Ramp inside XWalk2?	N/A
			N/A	Ramp inside XWalk1?	N/A
			0.0	Clear Space?	N/A
			5.0	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	N/A
			N/A	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00			

