

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53017	Main Street: STEEL_HOUSE_BV	Cross Street: CHARTRES_LN	Location: NW
ADA ID: 194C250B4C70	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

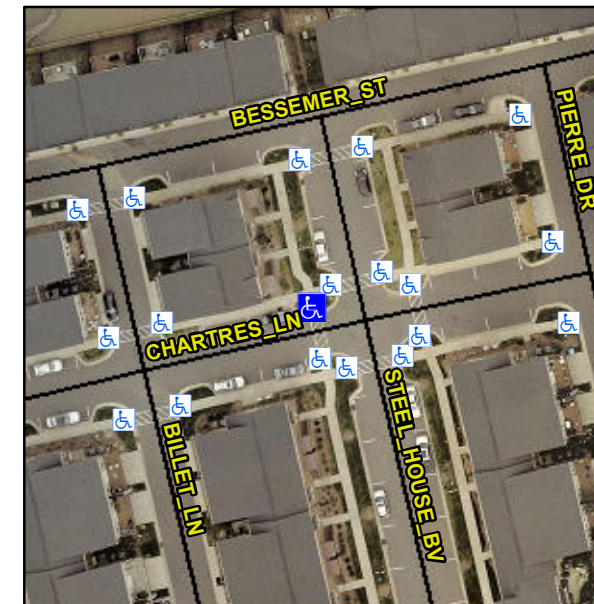

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R305.1.4, R305.2, R302.7.2, R304.5.3

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83.5	Yes	BlendTrans Slope (%)	3.4
Yes	Ramp Width (in)	69.0	Yes	BlendTrans XSlope (%)	0.4
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	65.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.7	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	3.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	65.5		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.1		Clear Space?	Yes
	Road X Slope (%)	1.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	6.5

